

Timing Belt Replacement Recommendations

Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)	Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)
ACURA				AMERICAN MOTORS			
Passenger Cars				Concord			
EL (Canadian)				1978-79	2.0L 4-Cyl.	T017 ³	60,000 ¹
1997-00	*1.6L 4-Cyl.	T224	105,000	Gremlin			
Integra				1977-78	2.0L 4-Cyl.	T017 ³	60,000 ¹
1986-89	*1.6L 4-Cyl.	T130	60,000 ¹	Spirit			
1992-93	*1.7L 4-Cyl.	T227	90,000	1979	2.0L 4-Cyl.	T017 ³	60,000 ¹
1990-94	*1.8L 4-Cyl. (Exc. VTEC)	T184	90,000	ASUNA			
1995-96	*1.8L 4-Cyl. (Exc. VTEC)	T184	90,000 Normal 60,000 Severe	Passenger Cars			
1997-01	*1.8L 4-Cyl. (Exc. VTEC)	T184	105,000	Sunfire (Canadian)			
1991-94	*1.8L 4-Cyl. (VTEC)	T247	90,000	1993	1.8L 4-Cyl.	T205	60,000
1995-96	*1.8L 4-Cyl. (VTEC)	T247	90,000 Normal 60,000 Severe	Light Trucks			
1997-01	*1.8L 4-Cyl. (VTEC)	T247	105,000	Sunrunner (Canadian)			
Legend				1989-95	1.6L 4-Cyl. (8-Valve) California Except California	T212 T164	60,000 60,000
1986-87	*2.5L V6	T129	60,000 ¹	1994-98			
1988-89	*2.7L V6	T129	60,000 ¹	1.6L 4-Cyl. (16-Valve) California	T212	60,000	
1990	*2.7L V6	T129	90,000	Except California	T164	60,000	
1991-94	*3.2L V6 (C32A1)	T193	90,000	1999-01	1.6L 4-Cyl. (16-Valve)	T212	60,000
1995	*3.2L V6 (C32A1)	T193	90,000 Normal	AUDI			
MDX				Allroad			
2001	*3.5L V6 (J35A3)	T286	105,000	2000	*2.7L V6 DOHC	T297	105,000
Vigor				A4			
1992-94	*2.5L 5-Cyl.	T211	90,000	1997-99	*1.8L 4-Cyl. Turbo	T291	90,000
2.2CL				1996	*2.8L V6, 12-Valve	T218	60,000 ¹
1997	*2.2L 4-Cyl.	T186	90,000 Normal ² 60,000 Severe	1997	*2.8L V6, 12-Valve	T218	90,000
	*Balance Shaft			1998	*2.8L V6, 30-Valve	T297	90,000
	*Camshaft	T244	90,000 Normal ² 60,000 Severe	1999	*2.8L V6, 30-Valve	T297	75,000
2.3CL				A4 Quattro			
1999-98	*2.3L 4-Cyl.	T186	105,000	1997-99	*1.8L 4-Cyl. Turbo	T291	90,000
	*Balance Shaft			1996	*2.8L V6, 12-Valve	T218	60,000 ¹
	*Camshaft	T244	105,000	1997	*2.8L V6, 12-Valve	T218	90,000
2.5TL				1998	*2.8L V6, 30-Valve	T297	90,000
1995-96	*2.5L 5-Cyl.	T211	90,000 Normal 60,000 Severe	1999	*2.8L V6, 30-Valve	T297	75,000
1997-98	*2.5L 5-Cyl.	T211	105,000	2000	*2.7L V6 DOHC	T297	105,000
3.0CL				A6			
1997-99	*3.0L V6 (J30A1)	T286	105,000	1995-96	*2.8L V6, 12-Valve	T218	60,000 ¹
3.2CL				1997	*2.8L V6, 12-Valve	T218	90,000
2001	*3.2L V6 (J32A1/A2)	T286	105,000	1998	*2.8L V6, 30-Valve	T297	90,000
3.2TL				1999	*2.8L V6, 30-Valve	T297	75,000
1996	*3.2L V6 (C32A6)	T193	90,000 Normal 60,000 Severe	2000	*2.8L V6, 30-Valve	T297	105,000
1997-98	*3.2L V6 (C32A6)	T193	105,000	A6 Quattro & Quattro Turbo			
1999-01	*3.2L V6 (J32A1)	T286	105,000	1995-96	*2.8L V6, 12-Valve	T218	60,000 ¹
3.5RL				1997	*2.8L V6, 12-Valve	T218	90,000
1996	*3.5L V6 (C35A1)	T280	90,000 Normal ² 60,000 Severe	1998	*2.8L V6, 30-Valve	T297	90,000
	*Balance Shaft			1999	*2.8L V6, 30-Valve	T297	75,000
	*Camshaft	T279	90,000 Normal ² 60,000 Severe	2000	*2.8L V6, 30-Valve	T297	105,000
1997-01	*3.5L V6	T280	105,000	A8			
	*Balance Shaft			1997-98	*3.7L V8 (AEW)	T207	90,000
	*Camshaft	T279	105,000	1999	*3.7L V8 (AEW)	T207	75,000
Light Trucks				A8 Quattro			
SLX				1997-98	*3.7L V8 (AEW)	T207	90,000
1996-97	3.2L V6 (SOHC)	T221	60,000	1999	*3.7L V8 (AEW)	T207	75,000
1999-98	3.5L V6 (DOHC)	T303	75,000	2000	*4.2L V8 (AKB, AUX & AYS)	T297	105,000
ALFA ROMEO				Cabriolet			
164L, LS & S				1994-96	*2.8L V6, 12-Valve	T218	60,000 ¹
1991-93	3.0L V6	T120	50,000	1997-98	*2.8L V6, 12-Valve	T218	90,000
				Coupe			
				1981-83	2.2L 5-Cyl.	T065	60,000 ¹
				1984-85	2.2L 5-Cyl. 113 Tooth Belt 120 Tooth Belt	T065 T127	60,000 ¹ 60,000 ¹

* - Interference Engine. Other interference engine applications may exist which are not listed here. See page 19 for interference engine cautions.
¹ - Although the vehicle manufacturer does not recommend a specific scheduled maintenance interval, belt manufacturers suggest the belt be replaced at 60,000 miles intervals.
² - The vehicle manufacturer recommends replacing all belts at the same time.
³ - A timing belt component kit is available for this application.

Timing Belt Replacement Recommendations

Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)	Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)
AUDI (Cont.)				AUDI (Cont.)			
Coupe GT				200 Quattro			
1986-87	2.2L 5-Cyl.	T127	60,000 ¹	1989	2.2L 5-Cyl. Thru Chas. 44K004457 From Chas. 44K004458	T127 T170 T170	60,000 ¹ 60,000 ¹ 60,000 ¹
Coupe Quattro				1990-91	2.2L 5-Cyl.	T170	60,000 ¹
1990-91	2.3L 5-Cyl.	T197	60,000 ¹	4000			
Fox				1980-83	1.7L 4-Cyl.	T017 ³	60,000 ¹
1973-79	1.6L 4-Cyl.	T017 ³	60,000 ¹	1982-83	1.6L 4-Cyl. Diesel	T043	60,000 ¹
Quattro				1980-81	2.2L 5-Cyl.	T065	60,000 ¹
1983	2.2L 5-Cyl.	T065	60,000 ¹	4000CS			
1984-85	2.2L 5-Cyl. 113 Tooth Belt 120 Tooth Belt	T065 T127	60,000 ¹ 60,000 ¹	1986-87	2.2L 5-Cyl.	T127	60,000 ¹
S4 Quattro				4000CS Quattro			
2001	*2.7L V6 DOHC	T297	105,000	1987	2.2L 5-Cyl.	T127	60,000 ¹
S4 Sedan				4000S			
1992-94	2.2L 5-Cyl. Turbo	T225	60,000 ¹	1984-87	*1.8L 4-Cyl.	T017 ³	60,000 ¹
S6				4000S Quattro			
1995	2.2L 5-Cyl. Turbo	T225	60,000 ¹	1984-85	2.2L 5-Cyl. 113 Tooth Belt 120 Tooth Belt	T065 T127	60,000 ¹ 60,000 ¹
S6 Quattro					120 Tooth Belt	T127	60,000 ¹
1995	2.2L 5-Cyl. Turbo	T225	60,000 ¹	1986	2.2L 5-Cyl.	T127	60,000 ¹
TT Coupe & Roadster				5000			
	*1.8L 4-Cyl. Turbo	T306	120,000	1979-83	2.0L 5-Cyl. Diesel *Camshaft *Injection Pump	T083 T082	60,000 ^{1,2} 60,000 ^{1,2}
V8 Quattro				1979-83	2.0L 5-Cyl. Turbo Diesel *Camshaft *Injection Pump	T083 T082	60,000 ^{1,2} 60,000 ^{1,2}
1990-91	3.6L V8 (PT Engine)	T207	60,000	1978-83	2.2L 5-Cyl. Turbo	T065	60,000 ¹
1992-94	4.2L V8 (ABH Engine)	T207	90,000	5000 Quattro			
80				1988	2.3L 5-Cyl.	T127	60,000 ¹
1988-90	2.0L 4-Cyl.	T017 ³	60,000 ¹	5000CS Quattro			
1991-92	2.3L 5-Cyl.	T170	60,000 ¹	1987-88	2.2L 5-Cyl.	T127	60,000 ¹
80 Quattro				5000S			
1988	2.3L 5-Cyl.	T127	60,000 ¹	1987-88	2.3L 5-Cyl.	T127	60,000 ¹
90				1984-85	2.2L 5-Cyl. 113 Tooth Belt 120 Tooth Belt	T065 T127	60,000 ¹ 60,000 ¹
1988-90	2.0L 4-Cyl.	T017 ³	60,000 ¹		2.2L 5-Cyl.	T127	60,000 ¹
1988	2.3L 5-Cyl.	T127	60,000 ¹	BMW			
1989	2.3L 5-Cyl. Up To Chas. 89J396702 From Chas. 89J396703	T127 T170	60,000 ¹ 60,000 ¹	325 Series			
1990-91	2.3L 5-Cyl.	T170	60,000 ¹	1987-88	2.5L 6-Cyl. *127 Tooth Belt *128 Tooth Belt	T131 T106	60,000 60,000
1993-95	*2.8L V6, 12-Valve	T218	60,000 ¹	1989-91	*2.5L 6-Cyl.	T131	60,000
90 Quattro				1984-88	2.7L 6-Cyl. *127 Tooth Belt *128 Tooth Belt	T131 T106	60,000 60,000
1988	2.3L 5-Cyl.	T127	60,000 ¹	525i			
1989	2.3L 5-Cyl. Up To Chas. 89J394742 From Chas. 89J394743	T127 T170	60,000 ¹ 60,000 ¹	1989-95	*2.5L 6-Cyl.	T131	60,000
1990-92	2.3L 5-Cyl.	T170	60,000 ¹	528e			
1993-95	*2.8L V6 (12-Valve)	T218	60,000 ¹	1982-88	2.7L 6-Cyl. *127 Tooth Belt *128 Tooth Belt	T131 T106	60,000 60,000
100				BUICK			
	2.3L 5-Cyl. Thru Chas. 063969 From Chas. 063970	T127 T170	60,000 ¹ 60,000 ¹	Skyhawk			
1990-91	2.3L 5-Cyl.	T170	60,000 ¹	1982-86	1.8L 4-Cyl.	T081	60,000 ¹
1992-94	*2.8L V6 (12-Valve)	T218	60,000 ¹	1987-88	2.0L 4-Cyl.	T081	60,000 ¹
100 Quattro				CADILLAC			
1988-91	2.3L 5-Cyl. Thru Chas. 063969 From Chas. 063970	T127 T170	60,000 ¹ 60,000 ¹	Catera			
1990-91	2.3L 5-Cyl.	T170	60,000 ¹	1997-01	*3.0L V6 (DOHC)	T285	100,000
1992-94	*2.8L V6 (12-Valve)	T218	60,000 ¹				
200							
1989	2.2L 5-Cyl. Up To Chas. 44K400000	T127	60,000 ¹				
1989	2.2L 5-Cyl. From Chas. 44K400001	T170	60,000 ¹				
1990-91	2.2L 5-Cyl.	T170	60,000 ¹				

* - Interference Engine. Other interference engine applications may exist which are not listed here. See page 19 for interference engine cautions.

¹ - Although the vehicle manufacturer does not recommend a specific scheduled maintenance interval, belt manufacturers suggest the belt be replaced at 60,000 miles intervals.

² - The vehicle manufacturer recommends replacing all belts at the same time.

³ - A timing belt component kit is available for this application.

Timing Belt Replacement Recommendations

Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)	Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)
CHEVROLET				CHRYSLER (Cont.)			
Passenger Cars				Intrepid (Canadian)			
Chevette				1998-99	*3.2L V6	T295	105,000
1976	1.4L 4-Cyl.	T037	60,000 ¹	2000	*3.2L V6	T295	100,000 Federal 105,000 California
1977	1.4L 4-Cyl.	T039	60,000 ¹	1993-94	3.5L V6	T219	105,000
1976	1.6L 4-Cyl.	T037	60,000 ¹	1995-97	3.5L V6	T255	105,000
1977-78	1.6L 4-Cyl.	T039	60,000 ¹	Laser			
1979-87	1.6L 4-Cyl.	T061	60,000 ¹	1984-86	2.2L 4-Cyl.	T071 ³	60,000 ¹
1981-86	*1.8L 4-Cyl. Diesel	T076	60,000 ¹	1986	2.5L 4-Cyl.	T114	60,000 ¹
Lumina (Exc. Van)				LeBaron & LeBaron GTS			
1991-95	*3.4L V6	T192	60,000	1982-88	2.2L 4-Cyl.	T071 ³	60,000 ¹
1996-97	*3.4L V6	T273	60,000	1989-90	2.2L 4-Cyl.	T153 ³	60,000 ¹
Metro				1986-87	2.5L 4-Cyl.	T114	60,000 ¹
1998-01	1.0L 3-Cyl.	T194 ³	100,000	1988	2.5L 4-Cyl.	T132	60,000 ¹
1998-01	1.3L 4-Cyl.	T194 ³	100,000	1989-94	2.5L 4-Cyl.	T153 ³	60,000 ¹
Monte Carlo				1990-93	3.0L V6 (SOHC)	T139 ³	60,000
1995	*3.4L V6	T192	60,000	1994-95	3.0L V6 (SOHC)	T139 ³	60,000 ¹
1996-97	*3.4L V6	T273	60,000	LHS			
Nova				1994	3.5L V6	T219	105,000
1988	1.6L 4-Cyl. (DOHC)	T112	60,000 ¹	1995-97	3.5L V6	T255	105,000
1985-88	1.6L 4-Cyl. (SOHC)	T070 ³	60,000 ¹	1998-99	3.5LV6	T295	105,000
Spectrum				2000	3.5LV6	T295	100,000 Federal 105,000 California
1985-87	1.5L 4-Cyl.	T118	60,000	New Yorker			
	*Up To 4/30/87		60,000	1983-88	2.2L 4-Cyl.	T071 ³	60,000 ¹
	*From 5/1/87		60,000	1986-87	2.5L 4-Cyl.	T114	60,000 ¹
1988-89	*1.5L 4-Cyl.	T162	60,000	1988	2.5L 4-Cyl.	T132	60,000 ¹
Sprint				1988-89	3.0L V6 (SOHC)	T139 ³	60,000
1985-88	1.0L 3-Cyl.	T095	60,000	1993-94	3.5L V6	T219	105,000
1989-91	1.0L 3-Cyl.	T166	60,000	1995-96	3.5L V6	T255	105,000
CHEVROLET/G.M.C.				Sebring Coupe			
Light Trucks				1995-99	*2.0L 4-Cyl. (DOHC, VIN Y)	T246	60,000
LUV				1995-00	*2.5L V6	T259	60,000
1981-82	*2.2L 4-Cyl. Diesel	T075	60,000	Sebring Convertible			
S10 & S15 Pickups				1996-99	2.4L 4-Cyl. (DOHC, VIN X)	T265	105,000
1983-85	*2.2L 4-Cyl. Diesel	T075	60,000	1997-00	*2.5L V6	T259	60,000
Tracker				TC			
1998	1.6L 4-Cyl. (16-Valve)	T212	60,000	1990	2.2L 4-Cyl. (DOHC, VIN R)	T153 ³	60,000 ¹
	California		60,000	1990-91	3.0L V6 (SOHC)	T139 ³	60,000
	Except California		60,000	Town & Country			
1999-01	1.6L 4-Cyl. (16-Valve)	T212	60,000	1982-88	2.2L 4-Cyl.	T071 ³	60,000 ¹
CHRYSLER				1986-87	2.5L 4-Cyl.	T114	60,000 ¹
Cirrus				1988	2.5L 4-Cyl.	T132	60,000 ¹
2000	*2.0L 4-Cyl. (SOHC, VIN C)	T245	100,000 Federal 105,000 California	300M			
1995-99	2.4L 4-Cyl. (DOHC, VIN X)	T265	105,000	1998-99	3.5LV6	T295	105,000
2000	2.4L 4-Cyl. (DOHC, VIN X)	T265	100,000 Federal 105,000 California	2000	3.5LV6	T295	100,000 Federal 105,000 California
1995-00	*2.5L V6	T259	60,000	DAEWOO			
Concorde				Leganza			
1998-99	*3.2L V6	T295	105,000	1999-01	*2.2L 4-Cyl. (DOHC)	T305	72,000 Federal 102,000 Federal
2000	*3.2L V6	T295	100,000 Federal 105,000 California	Lanos			
1993-94	3.5L V6	T219	105,000	1999-01	*1.6L 4-Cyl. (DOHC)	T310	60,000 Federal 102,000 Federal
1995-97	3.5L V6	T255	105,000	Nubira			
2000	3.5LV6	T295	100,000 Federal 105,000 California	1999-01	*2.0L 4-Cyl. (DOHC)	T309	72,000 Federal 102,000 Federal
E Class				Optima (Canadian)			
1983-84	2.2L 4-Cyl.	T071 ³	60,000 ¹	1988-91	1.6L 4-Cyl.	T081	60,000 ¹
Executive Limo (Canadian)				1988-89	2.0L 4-Cyl.	T081	60,000 ¹
1986	2.2L 4-Cyl.	T071 ³	60,000 ¹	1990-91	2.0L 4-Cyl.	T163 ³	60,000 ¹

* - Interference Engine. Other interference engine applications may exist which are not listed here. See page 19 for interference engine cautions.
1 - Although the vehicle manufacturer does not recommend a specific scheduled maintenance interval, belt manufacturers suggest the belt be replaced at 60,000 miles intervals.
2 - The vehicle manufacturer recommends replacing all belts at the same time.
3 - A timing belt component kit is available for this application.

Timing Belt Replacement Recommendations

Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)	Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)
DAIHATSU				DODGE (Cont.)			
Passenger Cars				Colt Wagon (Includes Canadian)			
Charade				1989-90	1.8L 4-Cyl. (VIN T)	T093	60,000
1988-92	*1.0L 3-Cyl.	T178	60,000	1992	2.4L 4-Cyl.		
1988-92	*1.3L 4-Cyl.	T181	60,000		Balance Shaft	T159	60,000 ²
Light Trucks					Camshaft	T204	60,000 ²
Rocky				1993	2.4L 4-Cyl.		
1990-92	*1.6L 4-Cyl.	T182	60,000		Balance Shaft	T159	60,000 ²
DATSUN (SEE NISSAN)					Camshaft	T230	60,000 ²
DODGE				1994	2.4L 4-Cyl.		
Passenger Cars					Balance Shaft	T168	60,000 ²
Aries					Camshaft	T230	60,000 ²
1981-88	2.2L 4-Cyl.	T071 ³	60,000 ¹	Colt 100 (Canadian)			
1989	2.2L 4-Cyl.	T153 ³	60,000 ¹	1989-90	*1.6L 4-Cyl. (DOHC)	T165	60,000
1986-87	2.5L 4-Cyl.	T114	60,000 ¹	Colt 200 (Canadian)			
1988	2.5L 4-Cyl.	T132	60,000 ¹	1989-90	*1.6L 4-Cyl. (DOHC)	T165	60,000
1989	2.5L 4-Cyl.	T153 ³	60,000 ¹	Daytona & Daytona Shelby			
Avenger				1984-88	2.2L 4-Cyl.	T071 ³	60,000 ¹
1995-99	*2.0L 4-Cyl. (DOHC, VIN Y)	T246	60,000	1989-93	2.2L 4-Cyl.	T153 ³	60,000 ¹
1995-00	*2.5L V6	T259	60,000	1992-93	2.2L 4-Cyl. (DOHC, VIN A)	T206	60,000 ¹
Challenger				1986-87	2.5L 4-Cyl.	T114	60,000 ¹
1978-79 (RWD)	1.6L 4-Cyl. w/o Bal. Shaft	T064	60,000	1988	2.5L 4-Cyl.	T132	60,000 ¹
1978-79	1.6L 4-Cyl.			1989-93	2.5L 4-Cyl.	T153 ³	60,000 ¹
	Balance Shaft	T062	60,000 ²	1990-93	3.0L V6 (SOHC)	T139 ³	60,000
	Camshaft	T013	60,000 ²	Dynasty			
Charger				1989-93	2.5L 4-Cyl.	T153 ³	60,000 ¹
1983	1.7L 4-Cyl.	T017 ³	60,000 ¹	1988-93	3.0L V6 (SOHC)	T139 ³	60,000
1983-87	2.2L 4-Cyl.	T071 ³	60,000 ¹	Expo (Canadian)			
Colt				1987-88	2.2L 4-Cyl.	T071 ³	60,000 ¹
1979-84	*1.4L 4-Cyl.	T073	60,000	1989	2.2L 4-Cyl.	T153 ³	60,000 ¹
1985-86	*1.5L 4-Cyl.	T073	60,000	Intrepid			
1987-90	*1.5L 4-Cyl.	T128 ³	60,000	1998-99	*3.2L V6	T295	105,000
1991-94	1.5L 4-Cyl.	T191 ³	60,000	2000	*3.2L V6	T295	100,000 Federal
1978-79 (RWD)	1.6L 4-Cyl. w/o Bal. Shaft	T064	60,000				105,000 California
1979-82 (FWD)	1.6L 4-Cyl. w/o Bal. Shaft	T064	60,000	1993-94	3.5L V6	T219	105,000
1983-89	1.6L 4-Cyl. w/o Bal. Shaft	T093	60,000	1995-97	3.5L V6	T255	105,000
1977-80	1.6L 4-Cyl.			2000	3.5L V6	T295	100,000 Federal
	Balance Shaft	T062	60,000 ²				105,000 California
	Camshaft	T013	60,000 ²	Lancer			
1989-90	*1.6L 4-Cyl. (DOHC)	T165	60,000	1985-88	2.2L 4-Cyl.	T071 ³	60,000 ¹
1989-90	1.8L 4-Cyl. (VIN T)	T093	60,000	1989	2.2L 4-Cyl.	T153 ³	60,000 ¹
1992-94	1.8L 4-Cyl. (VINs C & D)	T201	60,000	1986-87	2.5L 4-Cyl.	T114	60,000 ¹
Colt (Canadian)				1988	2.5L 4-Cyl.	T132	60,000 ¹
1985-86	*1.5L 4-Cyl.	T073	60,000	1989	2.5L 4-Cyl.	T153 ³	60,000 ¹
1989-91	*1.5L 4-Cyl.	T128 ³	60,000	Neon			
1992 & 1995	1.5L 4-Cyl.	T191 ³	60,000	1995-99	*2.0L 4-Cyl. (DOHC, VIN Y)	T246	105,000
Colt Vista (Includes Canadian)				1995-00	*2.0L 4-Cyl. (SOHC, VIN C)	T245	105,000
1992-94	1.8L 4-Cyl. (VINs C & D)	T201	60,000	Omni			
1984-86	2.0L 4-Cyl. (SOHC)			1978-83	1.7L 4-Cyl.	T017 ³	60,000 ¹
	Balance Shaft	T090	60,000 ²	1981-88	2.2L 4-Cyl.	T071 ³	60,000 ¹
	Camshaft	T089	60,000 ²	1989-90	2.2L 4-Cyl.	T153 ³	60,000 ¹
1987-91	2.0L 4-Cyl. (SOHC)			Rampage			
	Balance Shaft	T159 ³	60,000 ²	1982-84	2.2L 4-Cyl.	T071 ³	60,000 ¹
	Camshaft	T158 ³	60,000 ²	Shadow			
1992	2.4L 4-Cyl.			1987-88	2.2L 4-Cyl.	T071 ³	60,000 ¹
	Balance Shaft	T159	60,000 ²	1989-94	2.2L 4-Cyl.	T153 ³	60,000 ¹
	Camshaft	T204	60,000 ²	1988	2.5L 4-Cyl.	T132 ³	60,000 ¹
1993	2.4L 4-Cyl.			1989-94	2.5L 4-Cyl.	T153 ³	60,000 ¹
	Balance Shaft	T159	60,000 ²	1992-93	3.0L V6 (SOHC)	T139 ³	60,000
	Camshaft	T230	60,000 ²	1994	3.0L V6 (SOHC)	T139 ³	60,000
1994	2.4L 4-Cyl.			Spirit			
	Balance Shaft	T168	60,000 ²	1991-92	2.2L 4-Cyl. (DOHC, VIN A)	T206	60,000 ¹
	Camshaft	T230	60,000 ²	1985-89	2.5L 4-Cyl.	T153 ³	60,000 ¹
				1989-93	3.0L V6 (SOHC)	T139 ³	60,000
				1994-95	3.0L V6 (SOHC)	T139 ³	60,000

* - Interference Engine. Other interference engine applications may exist which are not listed here. See page 19 for interference engine cautions.

¹ - Although the vehicle manufacturer does not recommend a specific scheduled maintenance interval, belt manufacturers suggest the belt be replaced at 60,000 miles intervals.

² - The vehicle manufacturer recommends replacing all belts at the same time.

³ - A timing belt component kit is available for this application.

Timing Belt Replacement Recommendations

Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)	Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)
DODGE (Cont.)				DODGE/PLYMOUTH (Cont.)			
Stealth				Scamp Pickup			
1991-96	*3.0L V6 (DOHC)	T195	60,000	1983	2.2L 4-Cyl.	T071 ³	60,000 ¹
1991-93	3.0L V6 (SOHC)	T139 ³	60,000	Light Trucks			
1994-96	3.0L V6 (SOHC)	T139 ³	60,000	Voyager			
Stratus				1982-88	2.2L 4-Cyl.	T071 ³	60,000 ¹
2000	*2.0L 4-Cyl. (SOHC, VIN C)	T245	100,000 Federal 105,000 Calif.	1986-87	2.5L 4-Cyl.	T114	60,000 ¹
1995-99	2.4L 4-Cyl. (DOHC, VIN X)	T265	105,000	1988	2.5L 4-Cyl.	T132	60,000 ¹
2000	2.4L 4-Cyl. (DOHC, VIN X)	T265	100,000 Federal 105,000 California	1989-95	2.5L 4-Cyl.	T153 ³	60,000 ¹
1995-00	*2.5L V6	T259	60,000	1987-93	3.0L V6 (SOHC)	T139 ³	60,000
024				1994-96	3.0L V6 (SOHC)	T139 ³	60,000
1981-82	1.7L 4-Cyl.	T017 ³	60,000 ¹	1997-00	3.0L V6 (SOHC)	T139 ³	
1981-82	2.2L 4-Cyl.	T071 ³	60,000 ¹	1996-00	2.4L 4-Cyl. (DOHC, VIN B)	T265	120,000
400				EAGLE			
1982-83	2.2L 4-Cyl.	T071 ³	60,000 ¹	Medallion			
600				1989	2.2L 4-Cyl.	T140	60,000 ¹
1983-88	2.2L 4-Cyl.	T071 ³	60,000 ¹	Summit			
1986-87	2.5L 4-Cyl.	T114	60,000 ¹	1989-90	*1.5L 4-Cyl.	T128 ³	60,000
1988	2.5L 4-Cyl.	T132	60,000 ¹	1991-96	1.5L 4-Cyl.	T191 ³	60,000
2000 GTX (Canadian)				1989-90	*1.6L 4-Cyl. (DOHC)	T165	60,000
1989-92	2.0L 4-Cyl. (SOHC)			1992-96	1.8L 4-Cyl. (VINs C & D)	T201	60,000
	Balance Shaft	T159	60,000 ²	1992	2.4L 4-Cyl.		
	Camshaft	T155	60,000 ²		Balance Shaft	T159	60,000 ²
DODGE/PLYMOUTH					Camshaft	T204	60,000 ²
Light Trucks				1993-96	2.4L 4-Cyl.		
Caravan					Balance Shaft	T168	60,000 ²
1982-88	2.2L 4-Cyl.	T071 ³	60,000		Camshaft	T230	60,000 ²
1986-87	2.5L 4-Cyl.	T114	60,000 ¹	Summit Wagon			
1988	2.5L 4-Cyl.	T132	60,000 ¹	1992-96	1.8L 4-Cyl. (VINs C & D)	T201	60,000
1989-95	2.5L 4-Cyl.	T153 ³	60,000 ¹	Talon			
1996-00	2.4L 4-Cyl. (DOHC, VIN B)	T265	120,000	1993-94	1.8L 4-Cyl.		
1987-93	3.0L V6 (SOHC)	T139 ³	60,000		Balance Shaft	T159 ³	60,000 ²
1994-96	3.0L V6 (SOHC)	T139 ³	60,000		Camshaft	T158 ³	60,000 ²
1997-00	3.0L V6 (SOHC)	T139 ³	60,000	1995-98	*2.0L 4-Cyl. (DOHC, VIN Y)	T246	60,000
Dakota				1990-98	2.0L 4-Cyl. (DOHC)		
1987-88	2.2L 4-Cyl.	T071 ³	60,000 ¹		*Balance Shaft	T168 ³	60,000 ²
1989-95	2.5L 4-Cyl.	T153 ³	60,000 ¹		*Camshaft	T167 ³	60,000 ²
Mini Ram Van				Vision			
1984-87	2.2L 4-Cyl.	T071 ³	60,000 ¹	1993-94	3.5L V6	T219	105,000
1987	2.5L 4-Cyl.	T114	60,000 ¹	1995-97	3.5L V6	T255	105,000
1988	2.5L 4-Cyl.	T132	60,000 ¹	Vista (Canadian)			
1987-93	3.0L V6 (SOHC)	T139 ³	60,000	1989-91	*1.5L 4-Cyl.	T128 ³	60,000
Raider				1992	1.5L 4-Cyl.	T191 ³	60,000
1989	3.0L V6 (SOHC)	T139 ³	60,000	1989-90	*1.6L 4-Cyl. (DOHC)	T165	60,000
Ram 50				1989	1.6L 4-Cyl. w/o Bal. Shaft	T093	60,000
1983-86	2.0L 4-Cyl. (SOHC)			1989-91	2.0L 4-Cyl. (SOHC)		
	Balance Shaft	T090	60,000 ²		Balance Shaft	T159 ³	60,000 ²
	Camshaft	T089	60,000 ²		Camshaft	T158 ³	60,000 ²
1987-89	2.0L 4-Cyl. (SOHC)			2000GTX (Canadian)			
	Balance Shaft	T159 ³	60,000 ²	1989-93	2.0L 4-Cyl. (DOHC)		
	Camshaft	T158 ³	60,000 ²		*Balance Shaft	T168 ³	60,000 ²
1983-86	2.3L 4-Cyl. Diesel				*Camshaft	T167 ³	60,000 ²
	*Balance Shaft	T092	50,000 ²	1989-92	2.0L 4-Cyl. (SOHC)		
	*Camshaft	T091	50,000 ²		Balance Shaft	T159	60,000 ²
1990-92	2.4L 4-Cyl.				Camshaft	T155	60,000 ²
	Balance Shaft	T159 ³	60,000 ²	FIAT			
	Camshaft	T124 ³	60,000 ²	Brava			
1993	2.4L 4-Cyl.			1974-78	*1.8L 4-Cyl.	T020	25,000
	Balance Shaft	T168	60,000 ²	1979-83	*2.0L 4-Cyl.	T068	30,000
	Camshaft	T229	60,000 ²	Spider 2000			
1990-91	3.0L V6 (SOHC)	T139 ³	60,000	1979-82	*2.0L 4-Cyl.	T068	30,000
				Strada			
				1979-82	*1.5L 4-Cyl.	T069	30,000

* - Interference Engine. Other interference engine applications may exist which are not listed here. See page 19 for interference engine cautions.
1 - Although the vehicle manufacturer does not recommend a specific scheduled maintenance interval, belt manufacturers suggest the belt be replaced at 60,000 miles intervals.
2 - The vehicle manufacturer recommends replacing all belts at the same time.
3 - A timing belt component kit is available for this application.

Timing Belt Replacement Recommendations

Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)	Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)
FIAT (Cont.)				FORD (Cont.)			
X1/9				Pinto			
1974-78	*1.3L 4-Cyl.	T018	36,000	1971-74	2.0L 4-Cyl.	T013	60,000 ¹
1979-83	*1.5L 4-Cyl.	T069	30,000	1974-80	2.3L 4-Cyl.	T014 ³	60,000 ¹
124 Series				Probe			
1971-74	*1.6L 4-Cyl.	T020	25,000	1989-92	*2.2L 4-Cyl.	T134 ³	60,000
1974-78	*1.8L 4-Cyl.	T020	25,000	1993-97	*2.0L 4-Cyl.	T228 ³	60,000 Federal 105,000 California
128 Series				1993-97	2.5L V6	T214	60,000 Federal 105,000 California
1973-79	*1.3L 4-Cyl.	T018	36,000	Taurus SHO			
131 Series				1989-95	3.0L V6	T248	100,000
1975-78	*1.8L 4-Cyl.	T020	25,000	1993-95	3.2L V6	T248	100,000
FORD				Tempo			
Passenger Cars				1984-86	2.0L 4-Cyl. Diesel *Camshaft *Injection Pump	T103 T102	100,000 ² 100,000 ²
Aspire				Thunderbird			
1994-97	1.3L 4-Cyl.	T185	60,000 Federal 105,000 California	1983-88	2.3L 4-Cyl.	T014 ³	60,000 ¹
Contour				Light Trucks			
1995-97	2.0L 4-Cyl. (DOHC, VIN 3)	T258	60,000 ¹	Aerostar			
1998-00	2.0L 4-Cyl. (DOHC, VIN 3)	T294	Inspect at 120,000; Replace if needed.	1987	2.3L 4-Cyl.	T014 ³	60,000 ¹
Escort				Courier			
1981-85	*1.6L 4-Cyl. (SOHC)	T067 ³	60,000	1977-82	2.3L 4-Cyl.	T014 ³	60,000 ¹
1991-96	1.8L 4-Cyl. (DOHC)	T179 ³	60,000	Escape			
1985-90	*1.9L 4-Cyl.	T067 ³	60,000	2001	2.0L 4-Cyl. (DOHC)	T294	120,000
1991	1.9L 4-Cyl. *Before 3/25/1991 *After 3/26/1991	T067 ³ T194 ³	60,000 60,000	Ranger			
1992-96	*1.9L 4-Cyl.	T194 ³	60,000	1983-88	2.0L 4-Cyl.	T014 ³	60,000 ¹
1984-87	2.0L 4-Cyl. Diesel *Camshaft *Injection Pump	T103 T102	100,000 ² 100,000 ²	1983-91	2.3L 4-Cyl.	T014 ³	60,000 ¹
1997-00	2.0L 4-Cyl. (SOHC, VIN P)	T283	Inspect at 120,000; Replace if needed.	1992	2.3L 4-Cyl. Square Tooth Sprocket Round Tooth Sprocket	T014 T210 T210	60,000 ¹ 60,000 ¹ 60,000 ¹
2001	2.0L 4-Cyl. (SOHC, VIN P)	T283	120,000	1993-94	2.3L 4-Cyl.	T210	60,000 ¹
Escort Coupe & ZX2				1995-97	2.3L 4-Cyl.	T276	60,000
1998-00	2.0L 4-Cyl. (DOHC, VIN 3)	T294	Inspect at 120,000; Replace if needed.	1985-87	2.3L 4-Cyl. Diesel *Camshaft *Balance Shaft	T091 T092	60,000 ¹ 60,000 ¹
2001	2.0L 4-Cyl. (DOHC, VIN 3)	T294	120,000	1998-00	2.5L 4-Cyl.	T276	Inspect At 120,000; Replace if needed.
EXP				2001	2.5L 4-Cyl.	T276	120,000
1981-85	*1.6L 4-Cyl. (SOHC)	T067 ³	60,000	G.M.C. (SEE CHEVROLET/G.M.C.)			
1985-90	*1.9L 4-Cyl.	T067 ³	60,000	GEO			
Fairmont				Passenger Cars			
1978-83	2.3L 4-Cyl.	T014 ³	60,000 ¹	Metro			
Festiva				1989-92	1.0L 3-Cyl.	T166	60,000
1988-89	1.3L 4-Cyl.	T141 ³	60,000	1993	1.0L 3-Cyl. 4-Bolt Sprocket	T166	60,000
1990-93	1.3L 4-Cyl.	T185	60,000	1994-95	1.0L 3-Cyl.	T241	60,000
Focus				1996	1.0L 3-Cyl.	T194 ³	60,000
2000	2.0L 4-Cyl. (DOHC, VIN 3)	T294	Inspect at 120,000; Replace if needed.	1997-00	1.0L 3-Cyl.	T194 ³	100,000
2001	2.0L 4-Cyl. (DOHC, VIN 3)	T294	120,000	1992-93	1.3L 4-Cyl.	T095	60,000
2000	2.0L 4-Cyl. (SOHC, VIN P)	T283	Inspect at 120,000; Replace if needed.	1994	1.3L 4-Cyl.	T243	60,000
2001	2.0L 4-Cyl. (SOHC, VIN P)	T283	120,000	1995-97	1.3L 4-Cyl.	T272	60,000
Granada				Metro (Canadian)			
1981-82	2.3L 4-Cyl.	T014 ³	60,000 ¹	1992-93	1.3L 4-Cyl.	T095	60,000
LTD				1994	1.3L 4-Cyl.	T243	60,000
1983-86	2.3L 4-Cyl.	T014 ³	60,000 ¹	Prizm			
Mustang				1937-97	*1.6L 4-Cyl. (DOHC, VIN 6)	T236 ³	60,000
1974-91	2.3L 4-Cyl.	T014 ³	60,000 ¹	1993-97	*1.8L 4-Cyl. (DOHC, VIN B)	T235	60,000
1992	2.3L 4-Cyl. Square Tooth Sprocket Round Tooth Sprocket	T014 ³ T210	60,000 ¹ 60,000 ¹	Prizm GSI			
1993	2.3L 4-Cyl.	T210	60,000 ¹	1990-91	1.6L 4-Cyl. (DOHC)	T176	60,000

* - Interference Engine. Other interference engine applications may exist which are not listed here. See page 19 for interference engine cautions.

¹ - Although the vehicle manufacturer does not recommend a specific scheduled maintenance interval, belt manufacturers suggest the belt be replaced at 60,000 miles intervals.

² - The vehicle manufacturer recommends replacing all belts at the same time.

³ - A timing belt component kit is available for this application.

Timing Belt Replacement Recommendations

Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)	Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)
GEO (Cont.)				HONDA (Cont.)			
Spectrum				Civic			
1985	*1.5L 4-Cyl.	T118	60,000	1973-79	*1.2L 4-Cyl.	T028	60,000 ¹
1986-87	1.5L 4-Cyl.			1980-83	*1.3L 4-Cyl.		
	*Up To 6/30/1986	T118	60,000		*Canada	T028	60,000 ¹
	*From 7/1/1986	T162	60,000		*USA	T073	60,000 ¹
1988-89	*1.5L 4-Cyl.	T162	60,000	1984-85	*1.3L 4-Cyl.	T099	60,000 ¹
Storm				1986-87	*1.3L 4-Cyl.	T161	60,000 ¹
1990-91	1.6L 4-Cyl. (DOHC)	T169	60,000	1980-83	*1.5L 4-Cyl.	T041	60,000 ¹
1990-93	*1.6L 4-Cyl. (SOHC)	T177	30,000	1984-85	*1.5L 4-Cyl.	T099	60,000 ¹
1992-93	1.8L 4-Cyl. (DOHC)	T205	60,000	1986-87	*1.5L 4-Cyl.	T161 ³	60,000 ¹
Light Trucks				1988-89	*1.5L 4-Cyl.	T143 ³	60,000 ¹
Tracker				1990-94	*1.5L 4-Cyl.	T143 ³	90,000
1989-95	1.6L 4-Cyl. (8-Valve)			1995	*1.5L 4-Cyl.	T143 ³	90,000, Normal
	California	T212	60,000 ¹				60,000, Severe
	Except California	T164	60,000 ¹	1988-89	*1.6L 4-Cyl. (SOHC)	T145	60,000 ¹
1994-98	1.6L 4-Cyl. (16-Valve)			1991	*1.6L 4-Cyl. (SOHC)	T145	90,000
	California	T212	60,000	1992			
	Except California	T164	60,000	Except Si	*1.6L 4-Cyl. (SOHC)	T145	90,000
1999-01	1.6L 4-Cyl. (16-Valve)	T212	60,000	Si	*1.6L 4-Cyl. (SOHC)	T224	90,000
				1993-94	*1.6L 4-Cyl. (SOHC)	T224	90,000
				1995	*1.6L 4-Cyl. (SOHC)	T224	90,000 Normal
HONDA							60,000 Severe
Passenger Cars				1996	*1.6L 4-Cyl. (SOHC)	T224	90,000 Normal
Accord							60,000 Severe
1976-83	*1.6L 4-Cyl. (SOHC)	T041	60,000 ¹	1997-00	*1.6L 4-Cyl. (SOHC)	T224	105,000
1979-83	*1.8L 4-Cyl.	T041	60,000 ¹	2001	1.7L 4-Cyl. (SOHC)	T312	110,000
1984-85	*1.8L 4-Cyl.	T094 ³	60,000 ¹	Civic CVCC			
1986-89	*2.0L 4-Cyl.	T160 ³	60,000 ¹	1975	*1.5L 4-Cyl.	T036 ³	60,000 ¹
1990-93	*2.2L 4-Cyl. (SOHC)			1976-79	*1.5L 4-Cyl.	T041	60,000 ¹
	*Balance Shaft	T186 ³	90,000 ²	Civic CRX			
	*Camshaft	T187 ³	90,000 ²	1984	*1.3L 4-Cyl.	T099	60,000 ¹
1994 (EX)	2.2L 4-Cyl. (SOHC)			1984-85	*1.5L 4-Cyl.	T099	60,000 ¹
	*Balance Shaft	T186 ³	90,000 ²	1986-87	*1.5L 4-Cyl.	T161 ³	60,000 ¹
	*Camshaft	T244 ³	90,000 ²	1988-89	*1.6L 4-Cyl. (SOHC)	T145	60,000 ¹
1994 (Exc. EX)	2.2L 4-Cyl. (SOHC)			1990-91	*1.6L 4-Cyl. (SOHC)	T145	90,000
	*Balance Shaft	T186 ³	90,000 ²	Civic del Sol (Except VX)			
	*Camshaft	T187 ³	90,000 ²	1993-94	*1.5L 4-Cyl.	T143 ³	90,000
1995 (EX)	2.2L 4-Cyl. (SOHC)			1995	*1.5L 4-Cyl.	T143 ³	90,000, Normal
	*Balance Shaft	T186 ³	90,000 ² , Normal				60,000, Severe
			60,000 ² , Severe	1993-94	*1.6L 4-Cyl. (SOHC)	T224	90,000
	*Camshaft	T244 ³	90,000 ² , Normal	1995	*1.6L 4-Cyl. (SOHC)	T224	90,000 Normal
			60,000 ² , Severe				60,000 Severe
1995 (Exc. EX)	2.2L 4-Cyl. (SOHC)			1996	*1.6L 4-Cyl. (SOHC)	T224	90,000 Normal
	*Balance Shaft	T186 ³	90,000 ² , Normal				60,000 Severe
			60,000 ² , Severe	1997	*1.6L 4-Cyl. (SOHC)	T224	105,000
	*Camshaft	T187 ³	90,000 ² , Normal	1994	*1.6L 4-Cyl. (DOHC)	T227	90,000
			60,000 ² , Severe	1995-94	*1.6L 4-Cyl. (DOHC)	T227	90,000 Normal
1996	2.2L 4-Cyl. (SOHC)						60,000 Severe
	*Balance Shaft	T186	90,000 ² , Normal	1997	*1.6L 4-Cyl. (DOHC)	T227	105,000
			60,000 ² , Severe	Civic del Sol VX			
	*Camshaft (w/o VTEC)	T187 ³	90,000 ² , Normal	1993-94	*1.5L 4-Cyl.	T223	90,000
			60,000 ² , Severe	1995	*1.5L 4-Cyl.	T223	90,000, Normal
	*Camshaft (w/ VTEC)	T244 ³	90,000 ² , Normal				60,000, Severe
			60,000 ² , Severe	Civic VX			
1997	2.2L 4-Cyl. (SOHC)			1992-94	*1.5L 4-Cyl.	T223	90,000
	*Balance Shaft	T186	105,000 ²	1995	*1.5L 4-Cyl.	T223	90,000, Normal
	*Camshaft (w/o VTEC)	T187 ³	105,000 ²				60,000, Severe
1998-01	*Camshaft (w/ VTEC)	T244	105,000 ²	Prelude			
	2.3L 4-Cyl. (SOHC)			1980-82	*1.6L 4-Cyl. (SOHC)	T041	60,000 ¹
	*Balance Shaft	T186	105,000 ²	1979-82	*1.8L 4-Cyl.	T041	60,000 ¹
1996	*Camshaft	T244	105,000 ²	1983-85	*1.8L 4-Cyl.	T094 ³	60,000 ¹
	*2.7L V6	T263	90,000 Normal	1986-87	*1.8L 4-Cyl.	T160 ³	60,000 ¹
			60,000 Normal	1985	*2.0L 4-Cyl.	T094 ³	60,000 ¹
1997	*2.7L V6	T263	105,000	1986-87	*2.0L 4-Cyl. (SOHC)	T160 ³	60,000 ¹
1998-01	*3.0L V6	T286	105,000				

* - Interference Engine. Other interference engine applications may exist which are not listed here. See page 19 for interference engine cautions.

¹ - Although the vehicle manufacturer does not recommend a specific scheduled maintenance interval, belt manufacturers suggest the belt be replaced at 60,000 miles intervals.

² - The vehicle manufacturer recommends replacing all belts at the same time.

³ - A timing belt component kit is available for this application.

Timing Belt Replacement Recommendations

Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)	Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)
HONDA (Cont.)				HYUNDAI (Cont.)			
Prelude (continued)				Elantra (continued)			
1988-89	*2.0L 4-Cyl. (SOHC)	T144	60,000 ¹	1993-95	1.8L 4-Cyl. (DOHC)		
1990	*2.0L 4-Cyl. (SOHC)	T144	90,000		*Balance Shaft	T168 ³	60,000 ²
1988-89	*2.0L 4-Cyl. (DOHC)	T142	60,000 ¹		*Camshaft	T167 ³	60,000 ²
1990-91	*2.0L 4-Cyl. (DOHC)	T141	90,000	1996-98	*1.8L 4-Cyl.	T278	60,000
1990-91	*2.1L 4-Cyl. (DOHC)	T142	90,000	1999-01	*2.0L 4-Cyl.	T284	60,000
1993-94	2.2L 4-Cyl. (DOHC)			Excel			
	*Balance Shaft	T186 ³	90,000 ²	1986-89	*1.5L 4-Cyl. (SOHC)	T073	60,000
	*Camshaft	T226 ³	90,000 ²	1990-94	*1.5L 4-Cyl. (SOHC)	T128 ³	60,000
1995-96	2.2L 4-Cyl. (DOHC)			Scoupe			
	*Balance Shaft	T186 ³	90,000 ² , Normal	1991-93	*1.5L 4-Cyl. (SOHC)	T128 ³	60,000
			60,000 ² , Severe	1994-95	*1.5L 4-Cyl. (SOHC)	T128 ³	60,000
	*Camshaft	T226 ³	90,000 ² , Normal	Sonata			
			60,000 ² , Severe	1992-98	2.0L 4-Cyl. (DOHC)		
1997-01	2.2L 4-Cyl. (DOHC)				*Balance Shaft	T168 ³	60,000 ²
	*Balance Shaft	T186 ³	105,000 ²		*Camshaft	T167 ³	60,000 ²
	*Camshaft	T226 ³	105,000 ²	1989-91	2.4L 4-Cyl. (SOHC)		
1992-94	2.2L 4-Cyl. (SOHC)				*Balance Shaft	T159 ³	60,000 ²
	*Balance Shaft	T186 ³	90,000 ²		*Camshaft	T124 ³	60,000 ²
	*Camshaft	T187 ³	90,000 ²	1990-98	*3.0L V6	T139 ³	60,000
1995-96	2.2L 4-Cyl. (SOHC)			Tiburon			
	*Balance Shaft	T186 ³	90,000 ² , Normal	1997	*1.8L 4-Cyl.	T278	60,000
			60,000 ² , Severe	1999-01	*2.0L 4-Cyl.	T284	60,000
	*Camshaft	T187 ³	90,000 ² , Normal				
			60,000 ² , Severe	INFINITI			
1992-94	2.3L 4-Cyl. (DOHC)			Passenger Cars			
	*Balance Shaft	T186	90,000 ²	J30			
	*Camshaft	T216	90,000 ²	1993	*3.0L V6	T180	60,000
1995-96	2.3L 4-Cyl. (DOHC)			1994-97	*3.0L V6	T251	60,000
	*Balance Shaft	T186	90,000 ² , Normal	M30			
			60,000 ² , Severe	1990-92	*3.0L V6	T104	60,000
	*Camshaft	T216	90,000 ² , Normal	Light Trucks			
			60,000 ² , Severe	QX4			
Light Trucks				1997-01	3.3L V6 (SOHC)	T249	105,000
CR-V				ISUZU			
1997-01	*2.0L 4-Cyl.	T184	105,000	Passenger Cars			
Odyssey				I-Mark			
1995-96	2.2L 4-Cyl. (SOHC)			1981-84	*1.8L 4-Cyl. Diesel	T076	60,000
	*Balance Shaft	T186 ³	90,000 ²	1985-87	1.5L 4-Cyl.		
	*Camshaft	T187 ³	90,000 ²		*Up To 6/30/86	T118	60,000
1997	2.2L 4-Cyl. (SOHC)				*From 7/1/86	T162	60,000
	*Balance Shaft	T186 ³	105,000 ²	1988-89	*1.5L 4-Cyl.	T162	60,000
	*Camshaft	T187 ³	105,000 ²	1989	*1.6L 4-Cyl. (DOHC)	T169	60,000
1998	2.3L 4-Cyl. (SOHC)			Impulse			
	*Balance Shaft	T186	105,000 ²	1985-89	*2.0L 4-Cyl. Turbo	T121	60,000
	*Camshaft	T244	105,000 ²	1988-89	*2.3L 4-Cyl.	T122	60,000
1999-01	*3.5L V6	T286	105,000	1990-92	1.6L 4-Cyl. (DOHC)	T169	60,000
Passport				1991-93	*1.6L 4-Cyl. Turbo	T169	60,000
1994-96	*2.6L 4-Cyl.	T147	60,000	1992	1.8L 4-Cyl.	T205	60,000
1994-97	3.2L V6 (SOHC)	T221	60,000	Stylus			
1998-99	3.2L V6 (DOHC)	T303	75,000	1991	1.6L 4-Cyl. (DOHC)	T169	60,000
2000-01	3.2L V6 (DOHC)	T303	105,000	1991-93	1.6L 4-Cyl. (SOHC)	T177	60,000
HYUNDAI				1992-93	1.8L 4-Cyl.	T205	60,000
Accent				Light Trucks			
1995-96	*1.5L 4-Cyl. (DOHC)	T282	60,000	Amigo			
1997	*1.5L 4-Cyl. (DOHC)	T282	60,000	1998	*2.2L 4-Cyl.	T305	75,000
1995-96	*1.5L 4-Cyl. (SOHC)	T191 ³	60,000	1999-00	*2.2L 4-Cyl.	T305	100,000, Normal
1997-01	1.5L 4-Cyl. (SOHC)	T191 ³	60,000				75,000, Severe
2001	*1.6L 4-Cyl. (DOHC)	T282	60,000	1989-93	*2.3L 4-Cyl.	T122	60,000
Elantra				1989-94	*2.6L 4-Cyl.	T147	60,000
1992-95	1.6L 4-Cyl. (DOHC)			1998	3.2L V6	T303	75,000
	*Balance Shaft	T168	60,000 ²	1999	3.2L V6	T303	100,000 Normal
	*Camshaft	T165	60,000 ²				75,000 Severe

* - Interference Engine. Other interference engine applications may exist which are not listed here. See page 19 for interference engine cautions.

¹ - Although the vehicle manufacturer does not recommend a specific scheduled maintenance interval, belt manufacturers suggest the belt be replaced at 60,000 miles intervals.

² - The vehicle manufacturer recommends replacing all belts at the same time.

³ - A timing belt component kit is available for this application.

Timing Belt Replacement Recommendations

Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)	Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)
ISUZU (Cont.)				LANCIA			
Oasis				Beta			
1996	2.2L 4-Cyl. (SOHC)			1976-78	*1.8L 4-Cyl.	T020	25,000
	*Balance Shaft	T186 ³	90,000 ²	LEXUS			
1996 (cont'd)	*Camshaft	T187 ³	90,000 ²	ES250			
1997	2.2L 4-Cyl. (SOHC)			1990-91	2.5L V6	T157	60,000 ¹
	*Balance Shaft	T186 ³	105,000 ²	ES300			
	*Camshaft	T187 ³	105,000 ²	1992-93	3.0L V6	T200	60,000 ¹
1998	2.3L 4-Cyl. (SOHC)			1994-98	3.0L V6	T257	60,000 ¹
	*Balance Shaft	T186	105,000 ²	1999-01	3.0L V6	T257	90,000
	*Camshaft	T244	105,000 ²	GS300			
Pickup & P'UP				1993-97	3.0L 6-Cyl.	T215	60,000 ¹
1981-87	*2.2L 4-Cyl. Diesel	T075	60,000	1998-01	3.0L 6-Cyl.	T215	90,000
1986-95	*2.3L 4-Cyl.	T122	60,000	GS400			
1988-95	*2.6L 4-Cyl.	T147	60,000	1998-00	4.0L V8	T298	90,000
Rodeo				LS400			
1998	*2.2L 4-Cyl.	T305	75,000	1990-94	4.0L V8	T190	60,000 ¹
1999-00	*2.2L 4-Cyl.	T305	100,000, Normal 75,000, Severe	1995-97	4.0L V8	T190	90,000, Normal 60,000, Severe
2001	*2.2L 4-Cyl.	T305	75,000, Normal 60,000, Severe	1998-00	4.0L V8	T298	90,000
1991-97	*2.6L 4-Cyl.	T147	60,000	SC300			
1993-97	3.2L V6 (SOHC)	T221	60,000	1993-97	3.0L 6-Cyl.	T215	60,000 ¹
1998	3.2L V6	T303	75,000	1998-00	3.0L 6-Cyl.	T215	90,000
1999-01	3.2L V6	T303	100,000 Normal 75,000 Severe	SC400			
Trooper				1992-94	4.0L V8	T190	60,000 ¹
1990-91	*2.6L 4-Cyl.	T147	60,000	1995-97	4.0L V8	T190	90,000, Normal 60,000, Severe
1992-95	3.2L V6 (DOHC)	T220	60,000	1998-00	4.0L V8	T298	90,000
1992-97	3.2L V6 (SOHC)	T221	60,000	Light Trucks			
1998	3.5L V6	T303	75,000	LX470			
1999-01	3.5L V6	T303	100,000 Normal 75,000 Severe	1998-01	*4.7L V8	T298	90,000
Trooper II				RX-300			
1984-87	*2.2L 4-Cyl. Diesel	T075	60,000	1999-01	3.0L V6	T257	90,000
1986-87	*2.3L 4-Cyl.	T122	60,000	MAZDA			
1988-89	*2.6L 4-Cyl.	T147	60,000	Passenger Cars			
VehiCROSS				Miata & MX-5 Miata			
1999-01	3.5L V6	T303	100,000 Normal 75,000 Severe	1990-92	1.6L 4-Cyl. (DOHC)	T179 ³	60,000
KIA				1993	1.6L 4-Cyl. (DOHC)	T179 ³	60,000 Federal 105,000 Calif.
Passenger Cars				1994-96	1.8L 4-Cyl. (DOHC)	T179 ³	60,000 Federal 105,000 Calif.
Sephia				1997-00	1.8L 4-Cyl. (DOHC)	T179 ³	105,000
1994-95	*1.6L 4-Cyl. (SOHC)	T185	105,000 (Calif.)	1997-00	1.8L 4-Cyl. (DOHC)	T179 ³	60,000
1994-95	*1.6L 4-Cyl. (SOHC)	T185	60,000 (Exc. Calif.)	2001	1.8L 4-Cyl. (DOHC)	T179 ³	60,000
1996-97	*1.6L 4-Cyl. (DOHC)	T179 ³	105,000 (Calif.)	Millenia			
1996-97	*1.6L 4-Cyl. (DOHC)	T179 ³	60,000 (Exc. Calif.)	1995-96	2.3L V6 (Miller Cycle)	T267	60,000 Federal 105,000 Federal
1995-97	*1.8L 4-Cyl. (DOHC)	T179 ³	105,000 (Calif.)	1997-00	2.3L V6 (Miller Cycle)	T267	105,000
1995-97	*1.8L 4-Cyl. (DOHC)	T179 ³	60,000 (Exc. Calif.)	1997-00	2.3L V6 (Miller Cycle)	T267	60,000
1998-01	*1.8L 4-Cyl. (DOHC)	T302	105,000 (Calif.)	1995-96	2.5L V6	T214	60,000 Federal 105,000 Federal
1998-01	*1.8L 4-Cyl. (DOHC)	T302	60,000 (Exc. Calif.)	1997-00	2.5L V6	T214	105,000
1996-97	*1.8L 4-Cyl. (SOHC)	T185	105,000 (Calif.)	1997-00	2.5L V6	T214	60,000
1996-97	*1.8L 4-Cyl. (SOHC)	T185	60,000 (Exc. Calif.)	2001	2.5L V6	T214	105,000
Spectra				MX-3 (Includes Canadian)			
2000-01	*1.8L 4-Cyl. (DOHC)	T302	105,000 (Calif.)	1988-89	1.6L 4-Cyl. (DOHC)	T149	60,000
2000-01	*1.8L 4-Cyl. (DOHC)	T302	60,000 (Exc. Calif.)	1994-95	1.6L 4-Cyl. (DOHC)	T179 ³	60,000 Federal 105,000 Calif.
Light Trucks				1992	1.6L 4-Cyl. (SOHC)	T185	60,000
Sporgage				1993	1.6L 4-Cyl. (SOHC)	T185	60,000 Federal 105,000 Calif.
1995-01	*2.0L 4-Cyl. (DOHC)	T281	105,000 (Calif.)	1992	1.8L V6	T214	60,000
1995-01	*2.0L 4-Cyl. (DOHC)	T281	60,000 (Exc. Calif.)				
1995	*2.0L 4-Cyl. (SOHC)	T264	105,000 (Calif.)				
1995	*2.0L 4-Cyl. (SOHC)	T264	60,000 (Exc. Calif.)				

* - Interference Engine. Other interference engine applications may exist which are not listed here. See page 19 for interference engine cautions.

¹ - Although the vehicle manufacturer does not recommend a specific scheduled maintenance interval, belt manufacturers suggest the belt be replaced at 60,000 miles intervals.

² - The vehicle manufacturer recommends replacing all belts at the same time.

³ - A timing belt component kit is available for this application.

Timing Belt Replacement Recommendations

Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)	Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)
MAZDA (Cont.)				MAZDA (Cont.)			
MX-3 (Includes Canadian) (continued)				626 (continued)			
1993-95	1.8L V6	T214	60,000 Federal 105,000 Calif.	1997-00	2.5L V6	T214	105,000
MX-6				1997-00	2.5L V6	T214	60,000
1993	*2.0L 4-Cyl. (DOHC)	T228 ³	60,000	2001	2.5L V6	T214	105,000
1994-96	*2.0L 4-Cyl. (DOHC)	T228 ³	60,000 Federal 105,000 Calif.	929			
1997	*2.0L 4-Cyl. (DOHC)	T228 ³	105,000	1990-93	*3.0L V6 (DOHC)	T183	60,000
1997	*2.0L 4-Cyl. (DOHC)	T228 ³	60,000	1994-95	*3.0L V6 (DOHC)	T183	60,000 Federal 105,000 Calif.
1988-92	*2.2L 4-Cyl.	T134 ³	60,000	1988-91	*3.0L V6 (SOHC)	T146 ³	60,000
1993	2.5L V6	T214	60,000	Light Trucks			
1994-96	2.5L V6	T214	60,000 Federal 105,000 Federal	B2000			
1997	2.5L V6	T214	105,000	1986	2.0L 4-Cyl. (SOHC) *Up To Chas. 568707	T113	60,000
1997	2.5L V6	T214	60,000		*From Chas. 568708	T117	60,000
Protege				1987	*2.0L 4-Cyl. (SOHC)	T117	60,000
1995-97	1.5L 4-Cyl.	T266	60,000 (Ex. CA & MA)	B2200			
1995-97	1.5L 4-Cyl.	T266	105,000 (CA & MA)	1987-93	*2.2L 4-Cyl.	T134 ³	60,000
1998	1.5L 4-Cyl. Up To Eng. No. 19472	T266	60,000 (Ex. CA & MA) 105,000 (CA & MA)	B2300			
	From Eng. No. 19473	T308	60,000 (Ex. CA & MA) 105,000 (CA & MA)	1994	2.3L 4-Cyl.	T210	60,000
1999-00	1.6L 4-Cyl. (DOHC)	T308	60,000	1997-95	2.3L 4-Cyl.	T276	60,000
2001	1.6L 4-Cyl. (DOHC)	T308	105,000	B2500			
1990-92	1.8L 4-Cyl. (DOHC)	T179	60,000	1998-00	2.5L 4-Cyl.	T276	120,000
1993-95	1.8L 4-Cyl. (DOHC)	T179 ³	60,000 Federal 105,000 Calif.	MPV			
1995-96	1.8L 4-Cyl. (DOHC)	T179 ³	60,000 Federal 105,000 Calif.	1988-93	*3.0L V6 (SOHC)	T146 ³	60,000
1997-98	1.8L 4-Cyl. (DOHC)	T179 ³	60,000	1994-96	*3.0L V6 (SOHC)	T146 ³	60,000 Federal 105,000 Calif.
1997-98	1.8L 4-Cyl. (DOHC)	T179 ³	105,000	1997-98	*3.0L V6 (SOHC)	T146 ³	105,000
1999-00	1.8L 4-Cyl. (DOHC)	T316	60,000	1997-98	*3.0L V6 (SOHC)	T146 ³	60,000
1999-00	1.8L 4-Cyl. (DOHC)	T316	105,000	Tribute			
1990-92	1.8L 4-Cyl. (SOHC)	T185	60,000	2001	2.0L 4-Cyl. (DOHC)	T294	120,000
1993-94	1.8L 4-Cyl. (SOHC)	T185	60,000 Federal 105,000 Calif.	MERCURY			
2001	*2.0L 4-Cyl. (DOHC)	T228 ³	105,000	Passenger Cars			
323				Bobcat			
1988-89	1.6L 4-Cyl. (DOHC)	T149	60,000	1974-80	2.3L 4-Cyl.	T014 ³	60,000 ¹
1986	1.6L 4-Cyl. (SOHC)	T123	60,000	Capri			
1987-89	*1.6L 4-Cyl. (SOHC)	T141 ³	60,000	1972	1.6L 4-Cyl.	T013	60,000 ¹
1990-92	1.8L 4-Cyl. (SOHC)	T185	60,000	1971-74	2.0L 4-Cyl.	T013	60,000 ¹
1993-94	1.6L 4-Cyl. (SOHC)	T185	60,000 Federal 105,000 Calif.	1991-94	1.6L 4-Cyl. (DOHC)	T179 ³	60,000
				1976-86	2.3L 4-Cyl.	T014 ³	60,000 ¹
626				Cougar			
1983	*2.0L 4-Cyl. (SOHC)	T088	60,000	1981-86	2.3L 4-Cyl.	T014 ³	60,000 ¹
1984-85	2.0L 4-Cyl. *Square Tooth Sprocket	T088	60,000	1981-86	2.0L 4-Cyl. (DOHC, VIN 3)	T294	Inspect at 120,000, Replace if needed.
	*Round Tooth Sprocket	T113	60,000	1998-00	2.0L 4-Cyl. (DOHC, VIN 3)	T294	120,000
1986-87	*2.0L 4-Cyl.	T117	60,000	2001	2.0L 4-Cyl. (DOHC, VIN 3)	T294	120,000
1984-85	2.0L 4-Cyl. Diesel *Camshaft	T103	100,000	LN7			
	*Injection Pump	T102	100,000	1981-85	*1.6L 4-Cyl. (SOHC)	T067 ³	60,000
1993	*2.0L 4-Cyl. (DOHC)	T228 ³	60,000	1981-85	*1.6L 4-Cyl. (SOHC)	T067 ³	60,000
1994-96	*2.0L 4-Cyl. (DOHC)	T228 ³	60,000 Federal 105,000 Calif.	1985-87	*1.9L 4-Cyl.	T067 ³	60,000
1997-00	*2.0L 4-Cyl. (DOHC)	T228 ³	105,000	1984-87	2.0L 4-Cyl. Diesel *Camshaft	T103	100,000 ²
1997-00	*2.0L 4-Cyl. (DOHC)	T228 ³	60,000		*Injection Pump	T102	100,000 ²
2001	*2.0L 4-Cyl. (DOHC)	T228 ³	105,000	Marquis			
1988-92	*2.2L 4-Cyl.	T134 ³	60,000	1983-86	*2.3L 4-Cyl.	T014	60,000 ¹
1993	2.5L V6	T214	60,000	Mystique			
1994-96	2.5L V6	T214	60,000 Federal 105,000 Federal	1995-97	2.0L 4-Cyl. (DOHC, VIN 3)	T258	60,000 ¹
				1998-00	2.0L 4-Cyl. (DOHC, VIN 3)	T294	Inspect at 120,000, Replace if needed.
				Topaz			
				1984-86	2.0L 4-Cyl. Diesel *Camshaft	T103	100,000 ²
					*Injection Pump	T102	100,000 ²
				Tracer			
				1987-90	*1.6L 4-Cyl. (SOHC)	T141 ³	60,000

* - Interference Engine. Other interference engine applications may exist which are not listed here. See page 19 for interference engine cautions.

¹ - Although the vehicle manufacturer does not recommend a specific scheduled maintenance interval, belt manufacturers suggest the belt be replaced at 60,000 miles intervals.

² - The vehicle manufacturer recommends replacing all belts at the same time.

³ - A timing belt component kit is available for this application.

Timing Belt Replacement Recommendations

Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)	Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)
MERCURY (Cont.)				MITSUBISHI (Cont.)			
Tracer (continued)				Eclipse (continued)			
1991-96	1.8L 4-Cyl. (DOHC)	T179 ³	60,000	1995-97	2.0L 4-Cyl. (DOHC) Turbo	T168 ³	60,000 Federal ² 100,000 Calif. ²
1991	1.9L 4-Cyl.				*Balance Shaft		
	*Before 3/25/1991	T067 ³	60,000		*Camshaft	T167 ³	60,000 Federal ² 100,000 Calif. ²
	*After 3/26/1991	T194 ³	60,000				
1992-96	*1.9L 4-Cyl.	T194 ³	60,000	1998-99	2.0L 4-Cyl. (DOHC) Turbo	T168 ³	60,000 ² 100,000 ²
1997-00	2.0L 4-Cyl. (SOHC, VIN P)	T283	Inspect at 120,000, Replace if needed. 120,000		*Balance Shaft		
2001	2.0L 4-Cyl. (SOHC, VIN P)	T283			*Camshaft	T167 ³	60,000 ² 100,000 ²
Zephyr				1996	2.4L 4-Cyl. (SOHC, VIN G)	T168	60,000 Federal ² 100,000 Calif. ²
1978-83	2.3L 4-Cyl.	T014 ³	60,000 ¹		*Balance Shaft		
Light Trucks					*Camshaft	T230	60,000 Federal ² 100,000 Calif. ²
Villager				1997-98	2.4L 4-Cyl. (SOHC, VIN G)	T168	60,000 ² 60,000 ²
1993	*3.0L V6 (SOHC)	T104 ³	105,000		*Balance Shaft		
1994-98	*3.0L V6 (SOHC)	T249	105,000	2000-01	2.4L 4-Cyl. (SOHC, VIN G)	T232	60,000 ²
MERKUR				2000-01	*3.0L V6 (SOHC, 24-Valve)	T259	60,000
XR4Ti				Expo & Expo LRV			
1985-89	2.3L 4-Cyl.	T014 ³	60,000 ¹	1992-93	1.8L 4-Cyl. (VINs C & D)	T201	60,000
MITSUBISHI				1994	1.8L 4-Cyl. (VINs C & D)	T201	60,000 Federal 100,000 California
Passenger Cars				1992	2.4L 4-Cyl.	T159	60,000 ² 60,000 ²
Cordia & Tredia					Balance Shaft		
1983-84	1.8L 4-Cyl.	T090	60,000 ²		Camshaft	T204	
	Balance Shaft			1993-95	2.4L 4-Cyl.	T168	60,000 ² 60,000 ²
	Camshaft	T089	60,000 ²		Balance Shaft		
1985-86	1.8L 4-Cyl.	T159	60,000 ²		Camshaft	T230	
	Balance Shaft			Galant			
	Camshaft	T089	60,000 ²	1989-92	2.0L 4-Cyl.	T159 ³	60,000 ² 60,000 ²
1987-88	1.8L 4-Cyl.	T159 ³	60,000 ²		Balance Shaft		
	Balance Shaft				Camshaft	T155 ³	
	Camshaft	T158 ³	60,000 ²	1993	2.0L 4-Cyl.	T168 ³	60,000 ² 60,000 ²
1984	2.0L 4-Cyl.	T090	60,000 ²		Balance Shaft		
	Balance Shaft				Camshaft	T232 ³	
	Camshaft	T089	60,000 ²	1989-92	2.0L 4-Cyl. (DOHC)	T168 ³	60,000 ² 60,000 ²
1985-86	2.0L 4-Cyl.	T159	60,000 ²		*Balance Shaft		
	Balance Shaft				*Camshaft	T167 ³	
	Camshaft	T089	60,000 ²	1993	2.0L 4-Cyl. (DOHC)	T168 ³	60,000 ² 60,000 ²
1987-88	2.0L 4-Cyl.	T159	60,000 ²		*Balance Shaft		
	Balance Shaft				*Camshaft	T232 ³	
	Camshaft	T158	60,000 ²	1994	2.4L 4-Cyl. (DOHC)	T168	60,000 Federal 100,000 Calif.
Diamante					*Balance Shaft		
1992-93	*3.0L V6 (DOHC)	T195	60,000		Camshaft	T256 ³	60,000 Federal 100,000 Calif.
1994-96	*3.0L V6 (DOHC)	T195	60,000		*Up To May, 1994		
1992-93	3.0L V6 (SOHC, 12-Valve)	T139 ³	60,000		*From June, 1994	T230	60,000 Federal 100,000 Calif.
1994-96	3.0L V6 (SOHC, 12-Valve)	T139 ³	60,000 Federal 100,000 Calif.	1995-96	2.4L 4-Cyl. (DOHC)	T168	60,000 Federal 100,000 Calif.
					*Balance Shaft		
1997-01	*3.5L V6 (SOHC)	T287	60,000		*Camshaft	T230	60,000 Federal 100,000 Calif.
Eclipse				1985-87	2.4L 4-Cyl. (SOHC)	T159 ³	60,000 ² 60,000 ²
1990-94	1.8L 4-Cyl.				Balance Shaft		
	Balance Shaft	T159 ³	60,000 ²		Camshaft	T124 ³	
	Camshaft	T158 ³	60,000 ²				
1995-97	2.0L 4-Cyl. (Non-Turbo)	T246	60,000 Federal 100,000 Calif.				
	*DOHC, VIN Y						
1998-99	*2.0L 4-Cyl. (Non-Turbo)	T246	60,000				
	DOHC, VIN Y						
1990-94	2.0L 4-Cyl. (DOHC)	T168 ³	60,000 ²				
	*Balance Shaft						
	*Camshaft	T167 ³	60,000 ²				

* - Interference Engine. Other interference engine applications may exist which are not listed here. See page 19 for interference engine cautions.

¹ - Although the vehicle manufacturer does not recommend a specific scheduled maintenance interval, belt manufacturers suggest the belt be replaced at 60,000 miles intervals.

² - The vehicle manufacturer recommends replacing all belts at the same time.

³ - A timing belt component kit is available for this application.

Timing Belt Replacement Recommendations

Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)	Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)
MITSUBISHI (Cont.)				MITSUBISHI (Cont.)			
Galant (continued)				Pickup (continued)			
1994-96	2.4L 4-Cyl. (SOHC, VIN G) *Balance Shaft	T168	60,000 Federal ² 100,000 Calif. ²	1987-89	2.0L 4-Cyl. Balance Shaft Camshaft	T159 ³ T158 ³	60,000 ² 60,000 ²
	*Camshaft	T230	60,000 Federal ² 100,000 Calif. ²	1983-86	2.3L 4-Cyl. Diesel *Balance Shaft *Camshaft	T092 T091	50,000 ² 50,000 ²
1997-98	2.4L 4-Cyl. (SOHC, VIN G) *Balance Shaft *Camshaft	T168 T230	60,000 ² 60,000 ²	1990-92	2.4L 4-Cyl. Balance Shaft Camshaft	T159 ³ T124 ³	60,000 ² 60,000 ²
1999-01	2.4L 4-Cyl. (SOHC, VIN G) *Balance Shaft *Camshaft	T168 T232	60,000 ² 60,000 ²	1993-96	2.4L 4-Cyl. Balance Shaft Camshaft	T168 T229	60,000 ² 60,000 ²
1988	3.0L V6 (SOHC, 12-Valve)	T139 ³	60,000	1990-93	3.0L V6 (SOHC, 12-Valve)	T139 ³	60,000
1999-01	*3.0L V6 (SOHC, 24-Valve)	T259	60,000	1994	3.0L V6 (SOHC, 12-Valve)	T139 ³	60,000 Federal 100,000 Calif.
Mirage				Van			
1985-86	*1.5L 4-Cyl.	T073	60,000	1987-90	2.4L 4-Cyl. (SOHC) Balance Shaft Camshaft	T159 ³ T124 ³	60,000 ² 60,000 ²
1987-90	*1.5L 4-Cyl.	T128 ³	60,000				
1991-93	*1.5L 4-Cyl.	T191	60,000				
1994-96	*1.5L 4-Cyl.	T191 ³	60,000 Federal 60,000 Calif.				
1997-01	*1.5L 4-Cyl.	T289	100,000				
1997-01	*1.5L 4-Cyl.	T289	60,000				
1985-88	*1.6L 4-Cyl. (SOHC)	T093	60,000				
1989-92	*1.6L 4-Cyl. (DOHC)	T165	60,000				
1993	1.8L 4-Cyl. (VINs C & D)	T201	60,000				
1994-96	1.8L 4-Cyl. (VINs C & D)	T201	60,000 Federal 100,000 Calif.				
1997-00	1.8L 4-Cyl.	T288	100,000				
1997-00	1.8L 4-Cyl.	T288	60,000				
Precis							
1987-89	*1.5L 4-Cyl.	T073	60,000				
1990-93	*1.5L 4-Cyl.	T128 ³	60,000				
Sigma							
1989-90	3.0L V6 (SOHC, 12-Valve)	T139 ³	60,000				
Tredia (See Cordia)							
3000GT							
1991-93	*3.0L V6 (DOHC)	T195	60,000				
1992-98	*3.0L V6 (DOHC)	T195	60,000				
1997-98	3.0L V6 (SOHC, 12-Valve)	T139 ³	60,000				
Light Trucks							
Montero							
1989-93	3.0L V6 (SOHC, 12-Valve)	T139 ³	60,000				
1994	3.0L V6 (SOHC, 12-Valve)	T139 ³	60,000 Federal 100,000 Calif.				
1995-96	*3.0L V6 (SOHC, 24-Valve)	T259	60,000 Federal 100,000 Calif.				
1994-96	*3.5L V6 (DOHC)	T253	60,000 Federal 100,000 Calif.				
1997-00	*3.5L V6 (SOHC)	T287	60,000				
Montero Sport							
1997-98	2.4L 4-Cyl. (SOHC, VIN G) *Balance Shaft *Camshaft	T168 T230	60,000 ² 60,000 ²				
1999	2.4L 4-Cyl. (SOHC, VIN G) *Balance Shaft *Camshaft	T168 T232	60,000 ² 60,000 ²				
1997-01	*3.0L V6 (SOHC, 24-Valve)	T259	60,000				
1997-01	*3.5L V6 (SOHC)	T287	60,000				
Pickup							
1983-86	2.0L 4-Cyl. Balance Shaft Camshaft	T090 T089	60,000 ² 60,000 ²				

* - Interference Engine. Other interference engine applications may exist which are not listed here. See page 19 for interference engine cautions.

¹ - Although the vehicle manufacturer does not recommend a specific scheduled maintenance interval, belt manufacturers suggest the belt be replaced at 60,000 miles intervals.

² - The vehicle manufacturer recommends replacing all belts at the same time.

³ - A timing belt component kit is available for this application.

Timing Belt Replacement Recommendations

Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)	Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)
NISSAN (Cont.)				PLYMOUTH (Cont.)			
Pathfinder (continued)				Colt			
1993-94	3.0L V6 (SOHC)			1979-84	*1.4L 4-Cyl.	T073	60,000
	*Round Tooth Sprocket	T249	60,000	1985-86	*1.5L 4-Cyl.	T073	60,000
	*Square Tooth Sprocket	T104 ³	60,000	1987-90	*1.5L 4-Cyl.	T128 ³	60,000
1995-96	*3.0L V6 (SOHC)	T249	60,000	1991-94	1.5L 4-Cyl.	T191 ³	60,000
1999-00	*3.3L V6 (SOHC)	T249	105,000	1978-79 (RWD)	1.6L 4-Cyl. w/o Bal. Shaft	T064	60,000
Pickup				1979-82 (FWD)	1.6L 4-Cyl. w/o Bal. Shaft	T064	60,000
1986-92	*3.0L V6 (SOHC)	T104 ³	60,000	1983-89	1.6L 4-Cyl. w/o Bal. Shaft	T093	60,000
1993-94	3.0L V6 (SOHC)			1977-80	1.6L 4-Cyl.		
	*Round Tooth Sprocket	T249	60,000		Balance Shaft	T062	60,000 ²
	*Square Tooth Sprocket	T104 ³	60,000		Camshaft	T013	60,000 ²
1995-96	*3.0L V6 (SOHC)	T249	60,000	1989-90	*1.6L 4-Cyl. (DOHC)	T165	60,000
Quest				1989-90	1.8L 4-Cyl. (VIN T)	T093	60,000
1993-94	3.0L V6 (SOHC)			1992-94	1.8L 4-Cyl. (VINs C & D)	T201	60,000
	*Round Tooth Sprocket	T249	60,000	Colt Vista (Includes Canadian)			
	*Square Tooth Sprocket	T104 ³	60,000	1992-94	1.8L 4-Cyl. (VINs C & D)	T201	60,000
1995-98	*3.0L V6 (SOHC)	T249	60,000	1984-86	2.0L 4-Cyl. (SOHC)		
1999-01	3.3L V6 (SOHC)	T249	105,000		Balance Shaft	T090	60,000 ²
Xterra					Camshaft	T089	60,000 ²
2000-01	3.3L V6 (SOHC)	T249	105,000	1987-91	2.0L 4-Cyl. (SOHC)		
OLDSMOBILE					Balance Shaft	T159 ³	60,000 ²
Cutlass Supreme					Camshaft	T158 ³	60,000 ²
1991-95	*3.4L V6	T192	60,000	1992	2.4L 4-Cyl.		
1996	*3.4L V6	T273	60,000		Balance Shaft	T159	60,000 ²
Firenza					Camshaft	T204	60,000 ²
1982-86	1.8L 4-Cyl.	T081	60,000 ¹	1993	2.4L 4-Cyl.		
1987-88	2.0L 4-Cyl.	T081	60,000 ¹		Balance Shaft	T159	60,000 ²
PEUGEOT					Camshaft	T230	60,000 ²
405				1994	2.4L 4-Cyl.		
1989-91	1.9L 4-Cyl. (DOHC)	T188	60,000 ¹		Balance Shaft	T168	60,000 ²
1991-89	1.9L 4-Cyl. (SOHC)	T189	60,000 ¹		Camshaft	T230	60,000 ²
505				Colt 100 (Canadian)			
1986-91	2.2L 4-Cyl. (Exc. Turbo)	T140	60,000 ¹	1989-90	*1.6L 4-Cyl. (DOHC)	T165	60,000
PLYMOUTH				Colt 200 (Canadian)			
Passenger Cars				1989-90	*1.6L 4-Cyl. (DOHC)	T165	60,000
Acclaim				Horizon			
1985-89	2.5L 4-Cyl.	T153 ³	60,000 ¹	1978-83	1.7L 4-Cyl.	T017 ³	60,000 ¹
1989-93	3.0L V6 (SOHC)	T139 ³	60,000	1981-88	2.2L 4-Cyl.	T071 ³	60,000 ¹
1994-95	3.0L V6 (SOHC)	T139 ³	60,000	1989-90	2.2L 4-Cyl.	T153 ³	60,000 ¹
Arrow				Laser			
1978-80	1.6L 4-Cyl. w/o Bal. Shaft	T064	60,000	1990-94	1.8L 4-Cyl.		
1977-80	1.6L 4-Cyl.				Balance Shaft	T159 ³	60,000 ²
	Balance Shaft	T062	60,000 ²		Camshaft	T158 ³	60,000 ²
	Camshaft	T013	60,000 ²	1990-94	2.0L 4-Cyl. (DOHC)		
Breeze					*Balance Shaft	T168 ³	60,000 ²
1996-00	*2.0L 4-Cyl. (SOHC, VIN C)	T245	100,000 Federal 105,000 Calif.		*Camshaft	T167 ³	60,000 ²
1996-99	2.4L 4-Cyl. (DOHC, VIN X)	T265	105,000	Neon			
2000	2.4L 4-Cyl. (DOHC, VIN X)	T265	100,000 Federal 105,000 Calif.	1995-99	*2.0L 4-Cyl. (DOHC, VIN Y)	T246	105,000
Caravelle				1995-00	*2.0L 4-Cyl. (SOHC, VIN C)	T245	105,000
1983-88	2.2L 4-Cyl.	T071 ³	60,000 ¹	Reliant			
1986-87	2.5L 4-Cyl.	T114	60,000 ¹	1981-88	2.2L 4-Cyl.	T071 ³	60,000 ¹
1988	2.5L 4-Cyl.	T132	60,000 ¹	1989	2.2L 4-Cyl.	T153 ³	60,000 ¹
Champ				1986-87	2.5L 4-Cyl.	T114	60,000 ¹
1979-82	*1.4L 4-Cyl.	T073	60,000	1988	2.5L 4-Cyl.	T132	60,000 ¹
1979-82	1.6L 4-Cyl. w/o Bal. Shaft	T064	60,000	1989	2.5L 4-Cyl.	T153 ³	60,000 ¹
1979-80	1.6L 4-Cyl.			Sapporo			
	Balance Shaft	T062	60,000 ²	1978-80	1.6L 4-Cyl. w/o Bal. Shaft	T064	60,000
	Camshaft	T013	60,000 ²	1977-80	1.6L 4-Cyl.		
					Balance Shaft	T062	60,000 ²
					Camshaft	T013	60,000 ²
				1987-88	2.2L 4-Cyl.	T071 ³	60,000 ¹
				1989-94	2.2L 4-Cyl.	T153 ³	60,000 ¹
				1988	2.5L 4-Cyl.	T132	60,000 ¹

* - Interference Engine. Other interference engine applications may exist which are not listed here. See page 19 for interference engine cautions.

¹ - Although the vehicle manufacturer does not recommend a specific scheduled maintenance interval, belt manufacturers suggest the belt be replaced at 60,000 miles intervals.

² - The vehicle manufacturer recommends replacing all belts at the same time.

³ - A timing belt component kit is available for this application.

Timing Belt Replacement Recommendations

Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)	Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)
PLYMOUTH (Cont.)				PONTIAC (Cont.)			
Sundance				Light Trucks			
1989-94				Sunrunner (Canadian)			
1989-94	2.5L 4-Cyl.	T153 ³	60,000 ¹	1989-95	1.6L 4-Cyl. (8-Valve)		
1992-93	3.0L V6 (SOHC)	T139 ³	60,000		California	T212	60,000 ¹
1994	3.0L V6 (SOHC)	T139 ³	60,000		Except California	T164	60,000 ¹
TC3				1994-98	1.6L 4-Cyl. (16-Valve)		
1981-82	1.7L 4-Cyl.	T017 ³	60,000 ¹		California	T212	60,000
1981-82	2.2L 4-Cyl.	T071 ³	60,000 ¹		Except California	T164	60,000
Turismo				PORSCHE			
1983	1.7L 4-Cyl.	T017 ³	60,000 ¹	924			
1983-87	2.2L 4-Cyl.	T071 ³	60,000 ¹	1977-82	*2.0L 4-Cyl.	T017	45,000
Light Trucks				1987-88	2.5L 4-Cyl.		
(See DODGE/PLYMOUTH Light Trucks)					*Balance Shaft	T293	45,000
PONTIAC					*Camshaft	T107	45,000
Passenger Cars				928			
Acadian (Canadian)				1978-82	*4.5L V8	T196	60,000
1976	1.4L 4-Cyl.	T037	60,000 ¹	1983-84	*4.5L V8	T196	60,000
1977	1.4L 4-Cyl.	T039	60,000 ¹	1985-91	*5.0L V8	T196	60,000
1976	1.6L 4-Cyl.	T037	60,000 ¹	1992-95	*5.4L V8	T196	60,000
1977-78	1.6L 4-Cyl.	T039	60,000 ¹	944			
1979-87	1.6L 4-Cyl.	T061	60,000 ¹	1983-89	2.5L 4-Cyl.		
1981-85	*1.8L 4-Cyl. Diesel	T076	60,000 ¹		*Balance Shaft	T293	45,000
Firefly (Canadian)					*Camshaft	T107	45,000
1985-88	1.0L 3-Cyl.	T095	60,000	1989	2.7L 4-Cyl.		
1989-91	1.0L 3-Cyl.	T166	60,000		*Balance Shaft	T293	45,000
1994-95	1.0L 3-Cyl.	T243	60,000		*Camshaft	T107	45,000
1996-97	1.0L 3-Cyl.	T194 ³	60,000	1989-91	3.0L 4-Cyl.		
1998-00	1.0L 3-Cyl.	T194 ³	100,000		*Balance Shaft	T293	45,000
1995-97	1.3L 4-Cyl.	T272	60,000		*Camshaft	T152	45,000
1998-00	1.3L 4-Cyl.	T194 ³	100,000	944S & 944 Turbo			
Grand Am				1987-88	2.5L 4-Cyl.		
1987-88	2.0L 4-Cyl.	T081	60,000 ¹		*Balance Shaft	T293	45,000
1989	2.0L 4-Cyl. (Turbo)	T163 ³	60,000 ¹		*Camshaft	T152	45,000
Grand Prix				968			
1991-95	*3.4L V6	T192	60,000	1992-95	3.0L 4-Cyl.		
1996	*3.4L V6	T273	60,000		*Balance Shaft	T293	45,000
J2000					*Camshaft	T152	45,000
1982	1.8L 4-Cyl.	T081	60,000 ¹	RENAULT			
LeMans				Alliance & Encore			
1988-89	1.6L 4-Cyl.	T148	60,000 ¹	1985-87	*1.7L 4-Cyl.	T119	60,000 ¹
1990	1.6L 4-Cyl.			Fuego & Sportwagon			
	*With Tensioner	T203	60,000 ¹	1984-86	2.2L 4-Cyl.	T140	60,000 ¹
	*Without Tensioner	T148	60,000 ¹	SAAB			
1991-93	*1.6L 4-Cyl.	T203	60,000 ¹	900			
1989	2.0L 4-Cyl.			1994-97	*2.5L V6	T285	60,000
	First Design	T081	60,000 ¹	9000			
	Second Design	T163 ³	60,000 ¹	1995-97	*3.0L V6	T285	60,000
1990	2.0L 4-Cyl.	T163 ³	60,000 ¹	SATURN			
Sunbird				L Series			
1985-86	1.8L 4-Cyl.	T081	60,000 ¹	2000-01	*3.0L V6 (DOHC)	T285	100,000
1987-88	2.0L 4-Cyl.	T081	60,000 ¹	STERLING			
1989-94	2.0L 4-Cyl.	T163 ³	60,000 ¹	825			
Sunburst (Canadian)				1987-88	*2.5L V6	T129	60,000 ¹
1985-88	*1.5L 4-Cyl.	T162	60,000	827			
T1000				1989-91	*2.7L V6	T129	60,000 ¹
1981-82	1.6L 4-Cyl.	T061	60,000 ¹				
1000							
1983-87	1.6L 4-Cyl.	T061	60,000 ¹				
2000							
1983	1.8L 4-Cyl.	T081	60,000 ¹				
2000 Sunbird							
1984	1.8L 4-Cyl.	T081	60,000 ¹				

* - Interference Engine. Other interference engine applications may exist which are not listed here. See page 19 for interference engine cautions.
1 - Although the vehicle manufacturer does not recommend a specific scheduled maintenance interval, belt manufacturers suggest the belt be replaced at 60,000 miles intervals.
2 - The vehicle manufacturer recommends replacing all belts at the same time.
3 - A timing belt component kit is available for this application.

Timing Belt Replacement Recommendations

Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)	Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)
SUBARU				SUZUKI (Cont.)			
Coupe				Swift (continued)			
1985-89	1.8L 4-Cyl.			1993	1.3L 4-Cyl. (SOHC)	T095	60,000
	Right Hand Belt	T300 ³	52,000 ²	1994	1.3L 4-Cyl. (SOHC)	T243	60,000
	Left Hand Belt	T299 ³	52,000 ²	1995-97	1.3L 4-Cyl. (SOHC)	T272	60,000
Impreza & Outback Sport				1998-01	1.3L 4-Cyl. (SOHC)	T194 ³	60,000
1993	1.8L 4-Cyl.	T172 ³	60,000	Light Trucks			
1994	1.8L 4-Cyl.	T254	60,000	Samurai			
1995-97	1.8L 4-Cyl.	T254	60,000 Federal 105,000 Calif.	1985-92	1.3L 4-Cyl. (SOHC)	T095	60,000 ¹
1995-98	2.2L 4-Cyl.	T254	60,000 Federal 105,000 Calif.	1993	1.3L 4-Cyl. (SOHC)	T095	60,000
1999-01	2.2L 4-Cyl. (SOHC)	T304	105,000	1994	1.3L 4-Cyl. (SOHC)		
1996-97	2.5L 4-Cyl. (DOHC)	T277	60,000		VIN R4100375 & Earlier	T095	60,000
1998-99	2.5L 4-Cyl. (DOHC)	T277	105,000		From VIN R4100376	T243	60,000
Justy				1995	1.3L 4-Cyl.	T243	60,000
1987-95	1.2L 3-Cyl.	T135	60,000	Sidekick			
Legacy & Outback				1989	1.3L 4-Cyl. (SOHC)	T095	60,000 ¹
1993	2.2L 4-Cyl.	T172 ³	60,000	1989-91	1.6L 4-Cyl.	T164	60,000 ¹
1994	2.2L 4-Cyl.	T254	60,000	1992	1.6L 4-Cyl.		
1995-98	2.2L 4-Cyl.	T254	60,000 Federal 105,000 Calif.		Convertible	T164	60,000 ¹
1999-01	2.2L 4-Cyl. (SOHC)	T304	105,000		Hardtop	T212	60,000 ¹
1996-97	2.5L 4-Cyl. (DOHC)	T277	60,000	1993-95	1.6L 4-Cyl.		
1998-99	2.5L 4-Cyl. (DOHC)	T277	105,000		Convertible	T164	60,000
2000-01	2.5L 4-Cyl. (SOHC)	T307	105,000		Hardtop	T212	60,000
Loyale				1996-98	1.6L 4-Cyl.	T212	60,000
1990-94	1.8L 4-Cyl.			Vitara			
	Right Hand Belt	T300 ³	52,000 ²	1999-01	1.6L 4-Cyl.	T212	60,000
	Left Hand Belt	T299 ³	52,000 ²	X-90			
RX				1996-98	1.6L 4-Cyl.	T212	60,000
1985-89	1.8L 4-Cyl.			TOYOTA			
	Right Hand Belt	T300 ³	52,000 ²	Passenger Cars			
	Left Hand Belt	T299 ³	52,000 ²	Avalon			
Sedan & Station Wagon				1995-97	3.0L V6	T257	60,000, Severe
1985-89	1.8L 4-Cyl.			1998-01	3.0L V6	T257	90,000
	Right Hand Belt	T300 ³	52,000 ²	Camry			
	Left Hand Belt	T299 ³	52,000 ²	1984-85	1.8L 4-Cyl. Diesel	T098	60,000
SVX				1983-85	2.0L 4-Cyl.	T087 ³	60,000 ¹
1992-94	3.3L 6-Cyl.	T209	60,000	1986	2.0L 4-Cyl.	T087 ³	60,000, Severe
1995-97	3.3L 6-Cyl.	T209	60,000 Federal 105,000 Calif.	1987-91	2.0L 4-Cyl.	T199 ³	60,000, Severe
XT				1992-97	2.2L 4-Cyl.	T199 ³	60,000, Severe
1985-91	1.8L 4-Cyl.			1998-01	2.2L 4-Cyl.	T199 ³	90,000
	Right Hand Belt	T300 ³	52,000 ²	1988-91	2.5L V6	T157	60,000, Severe
	Left Hand Belt	T299 ³	52,000 ²	1992-93	3.0L V6	T200	60,000, Severe
XT6				1995-97	3.0L V6	T257	60,000, Severe
1988-91	2.7L 6-Cyl.			1998-01	3.0L V6	T257	90,000
	Right Hand Belt	T150	60,000 ²	Camry Solara			
	Left Hand Belt	T151	60,000 ²	1999-01	2.2L 4-Cyl.	T199 ³	90,000
Light Trucks				1998-01	3.0L V6	T257	90,000
Forester				Celica, Celica GT & ST			
1998	2.5L 4-Cyl. (DOHC)	T277	105,000	1990-92	1.6L 4-Cyl. (DOHC, 4A-F)	T036 ³	60,000, Severe
1999-01	2.5L 4-Cyl. (SOHC)	T304	105,000	1993	1.6L 4-Cyl. (DOHC, 4A-F)	T239	60,000, Severe
SUZUKI				1994-97	1.8L 4-Cyl. (7A-FE)	T235	60,000, Severe
Passenger Cars				1986	2.0L 4-Cyl.	T087 ³	60,000, Severe
Esteem				1987-89	2.0L 4-Cyl.	T199 ³	60,000, Severe
1995-00	1.6L 4-Cyl.	T212	60,000	1990-93	2.0L 4-Cyl.	T125	60,000, Severe
Esteem (Canadian)				1990-97	2.2L 4-Cyl.	T199 ³	60,000, Severe
2001	1.6L 4-Cyl.	T212	60,000	1998-01	2.2L 4-Cyl.	T199 ³	90,000
Swift				Celica GTS			
1989-92	*1.3L 4-Cyl. (DOHC)	T171	60,000 ¹	1986-88	2.0L 4-Cyl.	T125	60,000, Severe
1993-94	*1.3L 4-Cyl. (DOHC)	T171	60,000	1990-93	2.2L 4-Cyl.	T199 ³	60,000, Severe
1989-92	1.3L 4-Cyl. (SOHC)	T095	60,000 ¹	Celica Supra			
				1982-83	2.8L 6-Cyl.	T074	60,000, Severe
				1984-86	2.8L 6-Cyl.	T101	60,000, Severe
				Corolla			
				1983-85	1.6L 4-Cyl. (SOHC)	T070 ³	60,000 ¹

* - Interference Engine. Other interference engine applications may exist which are not listed here. See page 19 for interference engine cautions.

¹ - Although the vehicle manufacturer does not recommend a specific scheduled maintenance interval, belt manufacturers suggest the belt be replaced at 60,000 miles intervals.

² - The vehicle manufacturer recommends replacing all belts at the same time.

³ - A timing belt component kit is available for this application.

Timing Belt Replacement Recommendations

Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)	Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)
TOYOTA (Cont.)				TOYOTA (Cont.)			
Corolla (continued)				Sienna			
1986-88	1.6L 4-Cyl. (SOHC)	T070 ³	60,000, Severe	1998-01	3.0L V6	T257	90,000
1988-92	1.6L 4-Cyl. (DOHC, 4A-F)	T036 ³	60,000, Severe	Tacoma			
1993-97	1.6L 4-Cyl. (DOHC, 4A-F)	T236 ³	60,000, Severe	1995-97	3.4L V6	T271	60,000, Severe
1984-85	1.8L 4-Cyl. Diesel	T098	60,000	1999-01	3.4L V6	T271	90,000
1993-97	1.8L 4-Cyl. (7A-FE)	T235	60,000, Severe	Tundra			
Corolla FX & FX-16				2000-01	3.4L V6	T271	90,000
1986-88	1.6L 4-Cyl.	T070 ³	60,000, Severe	2000-01	*4.7L V8	T298	90,000
1985	1.6L 4-Cyl. (4A-GE)	T112	60,000 ¹	T100			
1986-88	1.6L 4-Cyl. (4A-GE)	T112	60,000, Severe	1995-97	3.4L V6	T271	60,000, Severe
Corolla GTS				1998	3.4L V6	T271	90,000
1989-91	1.6L 4-Cyl. (4A-GE/GELC)	T176	60,000, Severe	4Runner			
Corolla SR5				1988-92	3.0L V6 (3V-ZE)	T154	60,000, Severe
1985	1.6L 4-Cyl.	T070 ³	60,000 ¹	1993-95	3.0L V6 (3V-ZE)	T240	60,000, Severe
1986-88	1.6L 4-Cyl.	T070 ³	60,000, Severe	1996-97	3.4L V6	T271	60,000, Severe
Corolla Tercel				1999-01	3.4L V6	T271	90,000
1980-82	1.5L 4-Cyl.	T070 ³	60,000 ¹	VOLKSWAGEN			
Cressida				Passenger Cars			
1983	2.8L 6-Cyl.	T074	60,000, Severe	Beetle (New Beetle)			
1984-88	2.8L 6-Cyl.	T101	60,000, Severe	1999-01	*1.8L 4-Cyl. (APH & AWW)	T306	105,000
1989-91	3.0L 6-Cyl.	T126	60,000, Severe	1998-00	*2.0L 4-Cyl. (AEG)	T296	60,000 ¹
1992	3.0L 6-Cyl.	T237	60,000, Severe	2001	*2.0L 4-Cyl. (AEG)	T296	105,000
MR2				1998-01	*1.9L 4-Cyl. Diesel (ALH)	T301	60,000 (Man. Trans.) 40,000 (Auto. Trans.)
1985	1.6L 4-Cyl. (4A-GE)	T112	60,000 ¹	Cabrio			
1986-88	1.6L 4-Cyl. (4A-GE)	T112	60,000, Severe	1995-01	*2.0L 4-Cyl. (ABA)	T262	60,000 ¹
1989	1.6L 4-Cyl. (4A-GE)	T176	60,000, Severe	1999	*2.0L 4-Cyl. (AEG)	T296	60,000 ¹
1991-95	2.0L 4-Cyl.	T125	60,000, Severe	Cabriolet			
1991-95	2.2L 4-Cyl.	T199 ³	60,000, Severe	1985-89	*1.8L 4-Cyl. (DOHC)	T292	60,000 ¹
Paseo				1985-93	1.8L 4-Cyl. (SOHC)	T017 ³	60,000 ¹
1992-97	1.5L 4-Cyl. (5E-FE)	T208	60,000, Severe	Corrado			
1998	1.5L 4-Cyl. (5E-FE)	T208	90,000, Severe	1990-92	1.8L 4-Cyl. (SOHC)	T017 ³	60,000 ¹
1999	1.5L 4-Cyl. (5E-FE)	T208	90,000	Dasher			
Supra				1974-75	1.5L 4-Cyl.	T017 ³	60,000 ¹
1986-90	3.0L 6-Cyl. (7M-GE)	T126	60,000, Severe	1979-80	*1.5L 4-Cyl. Diesel	T043	60,000 ¹
1991-92	3.0L 6-Cyl. (7M-GE)	T237	60,000, Severe	1976-80	1.6L 4-Cyl.	T017 ³	60,000 ¹
1993-97	3.0L 6-Cyl. (2JZ)	T215	60,000, Severe	1981	*1.6L 4-Cyl. Diesel	T043	60,000 ¹
1998	3.0L 6-Cyl. (2JZ)	T215	90,000, Severe	Fox			
Tercel				1987-93	1.8L 4-Cyl. (SOHC)	T017 ³	60,000 ¹
1983-86	1.5L 4-Cyl. (3A-C))	T070 ³	60,000 ¹	Golf			
1987	1.5L 4-Cyl. (Sedan, 3E)	T136	60,000, Severe	1985-87	*1.6L 4-Cyl. Diesel	T043	60,000 ¹
1988-94	1.5L 4-Cyl. (3E)	T233 ³	60,000, Severe	1985-89	*1.8L 4-Cyl. (DOHC)	T292	60,000 ¹
1995-97	1.5L 4-Cyl. (5E-FE)	T208	60,000, Severe	1985-92	1.8L 4-Cyl. (SOHC)	T017 ³	60,000 ¹
1998	1.5L 4-Cyl. (5E-FE)	T208	90,000, Severe	1993-96	1.9L 4-Cyl. Diesel		
1999	1.5L 4-Cyl. (5E-FE)	T208	90,000		*AAZ, AHU & 1Z Engines	T242	60,000
Tercel Wagon				1999-01	*1.9L 4-Cyl. Diesel (ALH)	T301	60,000 (Man. Trans.) 40,000 (Auto. Trans.)
1987-88	1.5L 4-Cyl. (3A-C)	T070 ³	60,000, Severe	Golf (Canadian)			
Light Trucks				1988-92	*1.6L 4-Cyl. Diesel	T043	60,000 ¹
Highlander				1993-95	1.8L 4-Cyl. (SOHC)	T017 ³	60,000 ¹
2001	3.0L V6	T257	90,000	1995	*2.0L 4-Cyl. (ABA)	T262	60,000 ¹
Land Cruiser				GTI			
1998-01	*4.7L V8	T298	90,000	1985-89	*1.8L 4-Cyl. (DOHC)	T292	60,000 ¹
Pickup				1985-92	1.8L 4-Cyl. (SOHC)	T017 ³	60,000 ¹
1981	*2.2L 4-Cyl. Diesel	T079	100,000	1990-92	*2.0L 4-Cyl. (DOHC)	T292	60,000 ¹
1982	2.2L 4-Cyl. Diesel			1996-99	*2.0L 4-Cyl. (ABA)	T262	60,000 ¹
	*Up To May 31	T079	100,000	1999	*2.0L 4-Cyl. (AEG)	T296	60,000 ¹
	*From June 1	T084	100,000	GTI (Canadian)			
1983	*2.2L 4-Cyl. Diesel	T084	100,000	1993-95	*2.0L 4-Cyl. (ABA)	T262	60,000 ¹
1984-87	*2.4L 4-Cyl. Diesel	T084	100,000				
1988-92	3.0L V6 (3V-ZE)	T154	60,000, Severe				
1993-95	3.0L V6 (3V-ZE)	T240	60,000, Severe				
RAV4							
1996-97	2.0L 4-Cyl.	T199	60,000, Severe				
1998	2.0L 4-Cyl.	T199	90,000, Severe				
1999-00	2.0L 4-Cyl.	T199	90,000				

* - Interference Engine. Other interference engine applications may exist which are not listed here. See page 19 for interference engine cautions.

¹ - Although the vehicle manufacturer does not recommend a specific scheduled maintenance interval, belt manufacturers suggest the belt be replaced at 60,000 miles intervals.

² - The vehicle manufacturer recommends replacing all belts at the same time.

³ - A timing belt component kit is available for this application.

Timing Belt Replacement Recommendations

Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)	Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)
VOLKSWAGEN (Cont.)				VOLVO			
Jetta				C70, S70 & V70			
1980	1.6L 4-Cyl.	T017 ³	60,000 ¹	1998	2.3L 5-Cyl.		
1981-86	*1.6L 4-Cyl. Diesel	T043	60,000 ¹		*To Eng. VIN 1266127	T252	70,000
1989-92	*1.6L 4-Cyl. Diesel	T043	60,000 ¹		*From Eng. VIN 1266128	T311	70,000
1981-84	1.7L 4-Cyl.	T017 ³	60,000 ¹	1999-01	2.3L 5-Cyl.		
1985-89	*1.8L 4-Cyl. (DOHC)	T292	60,000 ¹		*To Eng. VIN 1266127	T252	105,000
1984-92	1.8L 4-Cyl. (SOHC)	T017 ³	60,000 ¹		*From Eng. VIN 1266128	T311	105,000
1993-98	1.9L 4-Cyl. Diesel			1998	2.4L 5-Cyl.		
	*AAZ, AHU & 1Z Engines	T242	60,000		*To Eng. VIN 1266127	T252	70,000
1999-01	*1.9L 4-Cyl. Diesel (ALH)	T301	60,000 (Man. Trans.) 40,000 (Auto. Trans.)		*From Eng. VIN 1266128	T311	70,000
1990-92	*2.0L 4-Cyl. (DOHC)	T292	60,000 ¹	1999-01	2.4L 5-Cyl.		
1993-99	*2.0L 4-Cyl. (ABA)	T262	60,000 ¹		*To Eng. VIN 1266127	T252	105,000
1999-00	*2.0L 4-Cyl. (AEG)	T296	60,000 ¹		*From Eng. VIN 1266128	T311	105,000
Jetta (Canadian)				Coupe			
1993-95	1.8L 4-Cyl. (SOHC)	T017 ³	60,000 ¹	1991	*2.3L 4-Cyl.	T032 ³	50,000
Passat				DL & GL			
1998-99	1.8L 4-Cyl. (AEB & ATW)			1980-83	*2.1L 4-Cyl.	T032 ³	40,000
	*152 Tooth Belt	T291	90,000	1982-85	*2.3L 4-Cyl.	T032 ³	40,000
	*153 Tooth Belt	T317	90,000	1980-84	2.4L 6-Cyl. Diesel		
2000-01	*1.8L 4-Cyl. (AUG & AWM)				*Camshaft	T083	75,000 ²
	*152 Tooth Belt	T291	105,000		*Injection Pump	T082	75,000 ²
	*153 Tooth Belt	T317	105,000	GLE (Canadian)			
1990-92	*2.0L 4-Cyl. (DOHC)	T292	60,000 ¹	1984	*2.1L 4-Cyl.	T032 ³	40,000
1993-96	*2.0L 4-Cyl. (ABA)	T262	60,000 ¹	GLT			
1998	*2.8L V6	T297	90,000	1981-83	*2.1L 4-Cyl.	T032 ³	40,000
1999	*2.8L V6	T297	75,000	GLT (Canadian)			
2000-01	*2.8L V6	T297	105,000	1983	*2.3L 4-Cyl.	T032 ³	40,000
Passat (Canadian)				GT Turbo			
1992-94	1.8L 4-Cyl. (SOHC)	T017 ³	60,000 ¹	1984-85	*2.1L 4-Cyl.	T032 ³	40,000
Quantum				S40 & V40			
1982-86	*1.6L 4-Cyl. Diesel	T043	60,000 ¹	2000-01	1.9L 4-Cyl. Turbo		
1982-83	1.7L 4-Cyl.	T017 ³	60,000 ¹		*Up Eng. VIN 1219110	T252	105,000
1985	1.8L 4-Cyl. (SOHC)	T017 ³	60,000 ¹		*From Eng. VIN 1219111	T311	105,000
1984-85	2.1L 5-Cyl.			S60			
	.70" Belt Width	T127	60,000 ¹	2001	2.3L 5-Cyl.		
	.75" Belt Width	T065	60,000 ¹		*To Eng. VIN 1266127	T252	105,000
1983-86	2.2L 5-Cyl.				*From Eng. VIN 1266128	T311	105,000
	.70" Belt Width	T127	60,000 ¹	2001	2.4L 5-Cyl.		
	.75" Belt Width	T065	60,000 ¹		*To Eng. VIN 1266127	T252	105,000
1987-88	2.2L 5-Cyl.	T127	60,000 ¹		*From Eng. VIN 1266128	T311	105,000
Rabbit				S90 & V90			
1975-79	1.5L 4-Cyl.	T017 ³	60,000 ¹	1997-98	*2.9L 6-Cyl.	T270	70,000
1977-80	*1.5L 4-Cyl. Diesel	T043	60,000 ¹	240			
1980	1.6L 4-Cyl.	T017 ³	60,000 ¹	1986-92	*2.3L 4-Cyl.	T032 ³	50,000
1981-84	*1.6L 4-Cyl. Diesel	T043	60,000 ¹	1993	*2.3L 4-Cyl.	T234	50,000
1981-84	1.7L 4-Cyl.	T017 ³	60,000 ¹	242, 244 & 245			
1983-84	1.8L 4-Cyl. (SOHC)	T017 ³	60,000 ¹	1976-79	*2.1L 4-Cyl.	T032 ³	40,000
Scirocco				740			
1978	1.5L 4-Cyl.	T017 ³	60,000 ¹	1986-92	*2.3L 4-Cyl.	T032 ³	50,000
1976-80	1.6L 4-Cyl.	T017 ³	60,000 ¹	1985-86	2.4L 6-Cyl. Diesel		
1981-83	1.7L 4-Cyl.	T017 ³	60,000 ¹		*Camshaft	T083	75,000 ²
1985-89	*1.8L 4-Cyl. (DOHC)	T292	60,000 ¹		*Injection Pump	T082	75,000 ²
1983-89	1.8L 4-Cyl. (SOHC)	T017 ³	60,000 ¹	740 (Canadian)			
Light Trucks				1986-88	2.3L 4-Cyl. (B234, DOHC)		
Pickup & Rabbit Pickup					*Balance Shaft	T174	50,000 ²
1980	*1.5L 4-Cyl. Diesel	T043	60,000 ¹		*Camshaft	T173	50,000 ²
1980	1.6L 4-Cyl.	T017 ³	60,000 ¹	1989	2.3L 4-Cyl. (B234, DOHC)		
1981-83	*1.6L 4-Cyl. Diesel	T043	60,000 ¹		Automatic Tensioner		
1981-83	1.7L 4-Cyl.	T017 ³	60,000 ¹		*Balance Shaft	T174	50,000 ²
Vanagon					*Camshaft	T198	50,000 ²
1982	*1.6L 4-Cyl. Diesel	T043	60,000 ¹		Manual Tensioner		
					*Balance Shaft	T174	50,000 ²
					*Camshaft	T173	50,000 ²

* - Interference Engine. Other interference engine applications may exist which are not listed here. See page 19 for interference engine cautions.

¹ - Although the vehicle manufacturer does not recommend a specific scheduled maintenance interval, belt manufacturers suggest the belt be replaced at 60,000 miles intervals.

² - The vehicle manufacturer recommends replacing all belts at the same time.

³ - A timing belt component kit is available for this application.

Timing Belt Replacement Recommendations

Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)	Make/ Model Year	Engine	Belt Part No.	Recommended Replacement (Miles)
VOLVO (Cont.)							
740 (Canadian) (continued)							
1990	2.3L 4-Cyl. (B234, DOHC)						
	*Balance Shaft	T174	50,000 ²				
	*Camshaft	T173	50,000 ²				
760							
1985-90	*2.3L 4-Cyl.	T032 ³	50,000				
1985	2.4L 6-Cyl. Diesel						
	*Camshaft	T083	75,000 ²				
	*Injection Pump	T082	75,000 ²				
760 GLE							
1984	*2.3L 4-Cyl.	T032 ³	40,000				
1983-84	2.4L 6-Cyl. Diesel						
	*Camshaft	T083	75,000 ²				
	*Injection Pump	T082	75,000 ²				
780							
198-90	*2.3L 4-Cyl.	T032 ³	50,000				
850							
1994	2.3L 5-Cyl. Turbo						
	*Up To Eng. No. 131034	T217	50,000				
	*From Eng. No. 131035	T252	70,000				
1995-97	*2.3L 5-Cyl. Turbo	T252	70,000				
1993	2.4L 5-Cyl. Turbo						
	*Up To Eng. No. 131034	T217	50,000				
	*From Eng. No. 131035	T252	70,000				
1994-97	*2.4L 5-Cyl. Turbo	T252	70,000				
850 (Canadian)							
1996	*2.3L 5-Cyl. Turbo	T252	70,000				
1995	2.4L 5-Cyl. Turbo						
	*Up To Eng. No. 131034	T217	70,000				
	*From Eng. No. 131035	T269	70,000				
940							
1991-92	*2.3L 4-Cyl.	T032 ³	50,000				
1993	*2.3L 4-Cyl.	T234	50,000				
1994-95	*2.3L 4-Cyl. (B230FT)	T234	50,000 w/o EGR 100,000 w/ EGR				
940 (Canadian)							
1991-92	2.3L 4-Cyl. (B234, DOHC)						
	*Balance Shaft	T174	50,000 ²				
	*Camshaft	T198	50,000 ²				
960							
1992	*2.9L 6-Cyl.	T217	30,000				
1993	*2.9L 6-Cyl.	T252	50,000				
1994	*2.9L 6-Cyl.	T252	50,000				
1995-97	*2.9L 6-Cyl.	T270	70,000				
YUGO							
GV Series							
1986-89	*1.1L 4-Cyl.	T018	60,000 ¹				
1987	*1.3L 4-Cyl.	T018	60,000 ¹				

* - Interference Engine. Other interference engine applications may exist which are not listed here. See page 19 for interference engine cautions.

¹ - Although the vehicle manufacturer does not recommend a specific scheduled maintenance interval, belt manufacturers suggest the belt be replaced at 60,000 miles intervals.


² - The vehicle manufacturer recommends replacing all belts at the same time.

³ - A timing belt component kit is available for this application.

Free Running or Interference? ***You and Your Customers Need to Know.***

Automobile engines can be classified as either Free-Running or Interference, depending on what occurs if piston/valve synchronization is lost.

As illustrated below, in the free-running engine with the crankshaft still moving, there is enough clearance between the valve and piston, even if the cam stops with a valve fully open.

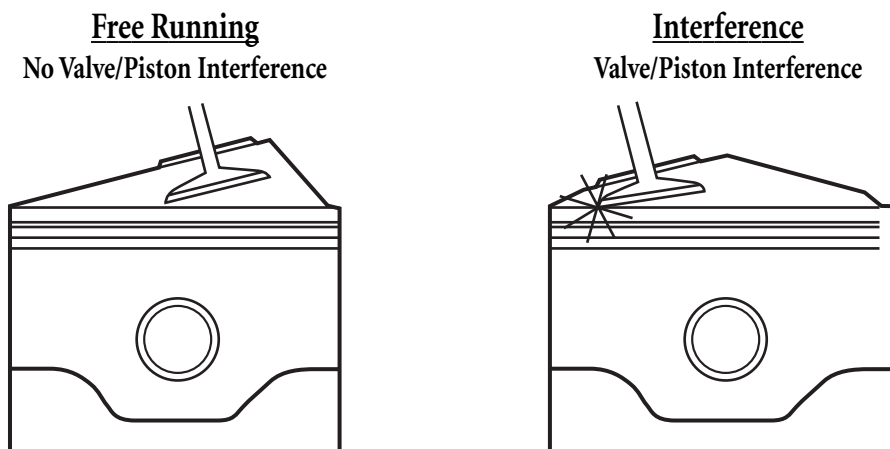

However, interference engines usually sustain damage if synchronization is lost. As illustrated, disrupted synchronization allows the piston and valve to collide causing damage and very expensive repairs for the vehicle owner. Damage can occur to valves, pistons, or heads, and in some cases, completely ruin the engine. Most imports (with higher compression engines) and most car and light truck diesel engines are interference. To avoid costly engine repairs, follow the auto manufacturers' mileage replacement recommendations or we recommend timing belt replacement at around 60,000 miles.

NOTE: For your convenience, interference engines have been footnoted with a star in the application listings of this publication. This lets you easily identify them...and pass that information on to your customers.

Since timing belts are inside the engine they tend to be an out-of-sight, out-of-mind item and are seldom thought of as a part of routine maintenance. Here are some questions to ask customers that will help sell belts and protect the customer from expensive repairs:

1. Did you buy the car new? If yes, they'll know if the belt has ever been replaced.
2. Did you buy the car used? If so, they won't know if the belt has been replaced. This is a flag for the customer to get the belt checked, replaced or at least be aware that he has a timing belt.
3. How many miles are on the vehicle? Generally belts should be replaced at around 60,000 miles or less. Our Timing Belt Replacement Recommendations Booklet is an excellent tool for determining replacement intervals.
4. Have you ever replaced the timing belt? If the answer is yes or no (and the customer knows the mileage) you can determine where the vehicle is in the replacement cycle.

Here's a helpful hint for customers with vehicles within a few thousand miles of the recommended replacement interval. If they are having any engine repair done, have the timing belt checked. If it needs replacing, do it along with the other repairs and save time and money.